

REG	MODEL	A-TCDS	TCDS	SN	YEAR	MANDATORY SERVICE BULLETINES & ADS							MRF	JVK-2018-04	SIGN:	CAMO	HNAB, SE.MG.0092				
SE-JVK	AS350BA	R.008	6	1922	1986	AIRFRAME "ASB" ADS					PAGE	of	Update EASA:	BW 2019-04	CAT = ASB-SB-TB		Date:	22-11 2018			
Date	ATA	SB	Rev	EASA	FAA-AD	FR-AD	MOD	ACTION			BA	PART	REP	F.DUE	D. DATE	CAT	REMARK	ACTION TAKEN	W.O.	DATE	MECH
07-12		00-01						AIM AND USE OF SB			X	I		1		ASB		C.W IN DECISIONS OF NEW ASB	HNAB CAMO	2018-03-01	SE-MG.0092, ARS-3 LGD
		01-03			80-15-05	79-134-008		SPHERICAL THRUST BEARING REAR BLOCK			X	I		1		ASB		NOT APPLICABLE BY PART NUMBER	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		01-04	1			79-210-010					X	I		1		ASB		N/A BY MODEL	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		01-06				81-084-017					X	I		1		ASB		FOUND P.C.W	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		01-07	2		81-13-09R2	81-184-020		TAIL ROTOR BLADES PITCH HORN			X	I		1		ASB		NOT APPLICABLE BY PART NUMBER	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
82-02		01-08				82-023-023		LE BOZEC ET GAUTHIER FUEL FILTER , FILTER CLOGGING TEST			X	I		1		ASB	EVERY 100 HRS	INCORP. PUBLICATION MSM	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
		01-10				83-075-33		WITHDRAWING T/R FROM SERVICE			X	I		1		ASB		NOT APPLICABLE BY PART NUMBER	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		01-11				84-073		BUCKLES SAFETY BELT PACIFIC COMPANY			X	I		1		ASB		N/A THIS AIRCRAFT BY TYPE T.S.O BELTS INSTALLED	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		01-13						INSTALLATION OF A NEW BLANKING PLUG PN 350A77-1213-21			X	I		1		ASB		NOT APPLICABLE BY PART NUMBER	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		01-14				85-135-042		VERIFYING LE BOZEC ET GAUTHIER FUEL FILTER PN 432B12-3C AND MGB OIL FILTER PN 434B12-11			X	I		1		ASB		NOT APPLICABLE BY PART NUMBER	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		01-15						CHECKING THE ENGINE MOUNT INSTALLATION			X	I		1		ASB		NOT APPLICABLE BY PART NUMBER	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		01-16			86-19-15R1	86-057-044r1		M/R HEAD ROVING BLADE SLEEVE, UPPER AND LOWER SLEEVE ATTACH BEAMS, 350A31-1830-00/01, -1831-ALL DASH			X	I		1		ASB		SEE COMPONENT RUN SHEET, TRACKED UNDER AD 86-19-15R1 (NOW IN MSR)	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		01-17			2000-20-19	86-125-048r1		BEHAVIOUR OF THE HELICOPTER ON THE GROUND WITH ROTOR TURNING			X	I		1		ASB	600 HRS INSP.,	PCW, SEE RECURRING TIME SHEET FOR NEXT DUE TIME UNDER AD 2000-20-19	10-1071	17-5-2010	HELITENDER INC CRS 1HTR181B
		01-18	2			83-84-25		PARTS REMOVAL FROM SERVICE			X	I		1		ASB		FOUND P.C.W	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		01-19				87-115-050		FLIGHT CYCLE CALCULATION			X	I		1		ASB		THIS SB IS NOW INCORP. IN MSR	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		01-20				87-161-051		THRUST BEARING BOLTS PN 350A31-2051-20 AND -2067-20			X	I		1		ASB		N/A BY P/N	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		01-21	1			88-184-052R1		DUNLOP SERVO CONTROLS INSP SCREWS			X	I		1		ASB	SB 67-11R1	FOUND P.C.W	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		01-22	1					M/R BLADES PN 355A11-0020-02/-03/-04/-06, MOD SERVICE LIFE			X	I		1		ASB		N/A BY P/N OF BLADES	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		01-23				89-081-053		LIMITS SPHERICAL THRUST BEARING -109			X	I		1		ASB		N/A BY P/N INST	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		01-24	1					PAULSTRA SPHERICAL THRUST BEARINGS, PN 704A33-633-156, WHICH WITHSTANDS TEMP. DWN TO -40C			X	I		1		ASB		N/A DUE TO P/N	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		01-25				90-105	TU211, 212	ARRIEL ENGINES MOD			X	I		1		ASB		P.C.W	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		01-27						HOIST			X	I		1		ASB		NA, NOT INSTALLED	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		01-28				5582		T/R LAMINATED BEARINGS			X	I		1		ASB		NA DUE TO P/N	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B

REG	MODEL	A-TCDS	TCDS	SN	YEAR	MANDATORY SERVICE BULLETINES & ADS										MRF	JVK-2018-04	SIGN:	CAMO	HNAB, SE.MG.0092			
SE-JVK	AS350BA	R.008	6	1922	1986	AIRFRAME "ASB" ADS										PAGE	of	Update EASA:	BW 2019-04	CAT = ASB-SB-TB		Date:	22-11 2018
Date	ATA	SB	Rev	EASA	FAA-AD	FR-AD	MOD	ACTION				BA	PART	REP	F.DUE	D. DATE	CAT	REMARK	ACTION TAKEN	W.O.	DATE	MECH	
		01-29	1			90-198-056r1		BATTERY TEMPERATURE PROBE				X	I		1		ASB	REF SB 24-02	N/A DUE TO P/N ON BATTERY	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		01-30						LUCAS AIR EQUIPMENT ELECTRICAL RESCUE HOIST				X	I		1		ASB		NOT INST.	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		01-32				91-156r1	TU221	ARRIEL FREE-WHEEL				X	I		1		ASB		P.C.W	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		01-33				91-137-059		TGB- PITCH CONTR. LEVER EXP. PIN				X	I		1		ASB		P.C.W, NOW IN MSR	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		01-34				91-159-060		BALL BEARINGS T/R DRIVE				X	I		1		ASB	INCORP ON AC AFTER 20-07-91	N/A DUE TO P/N	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
16-04		01-35	10					CONVERSION OF AS350B TO BA				X	I				SB	BA CONVERSION	C.W.	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		01-36				92-145-062	0667	HYDRAULIC SYSTEM CONTAMINATION				X	I		1		ASB		P.C.W	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		01-38				92-159-063r2	2598	FIRE DETECTION IN ENGINE BAY				X	I		1		ASB	REF SB 26-01	P.C.W	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		01-41				93-030-065		CHECK FOR CORRECT ASSEMBLY OF MAIN ROTOR MAST , EQUIPPED WITH 4 CONTACT BRG				X	I		1		ASB		NA DUE TO PN INSTALLED	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		01-42				96-07-03	94-180-069	CYCLIC PITCH CHANGE CONTROL ROD, PN 704A34-113-279				X	I		1		ASB		FOUND P.C.W CONFIRMED LOCK INST.	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		01-43				95-11-06	94-087-068	7152	MGB OIL PRESSURE INDICATOR SWITCH, PN 704A37-721-082				X	I		1		ASB		FOUND P.C.W	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		01-44					94-279-070r2	CHECKING BRG OIL JET ON TIMKEN M/R SHAFTS PN 350A37.0003 ALL DASH NUMBERS				X	I		1		ASB		N/E DUE TO MAST TYPE	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
02-03		01-46				98-06-12	97-147-072r1	TAIL BOOM ATTACHMENT BOLT CHECK				X	I		1		ASB		ALL BOLTS REPLACED AT TIME OF C/W SB 05.43 NO "M" BOLTS INST.	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		01-47				2000-10-09	98-511-074	CHECK OF SINGLE-POLE CICUIT BREAKERS				X	I		1		ASB		N/A BY DATE OF BREAKER INST.	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
01-02		01-48				2002-06-04	01-074-081	LIFE T/R HUB PITCH CHANGE PLATE BEARING				X	I		1		ASB		N/A BY P/N OF BEARING INST.	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
10-11		01-49				09-0122R1	2002-15-08	01-318	EQUIPMENT AND FURNISHINGS - LOAD RELEASE UNITS - INSPECTION / MODIFICATION / LIMITATION				X	I		1		ASB	SS AD F-2001-318	NA, NOT INSTALLED		26-10-2016	HELIAIR, SE.MG.0064
		01-51						CONVERSION OF AS350B TO BA				X	I				TB		C.W MODIFICATION				
03-03		01-52	1	*		2003-22-11	03-099A	EXCHANGE SERVO TYPE TRW-SAMM				X	I		1		ASB	SS AD 2001-26-53	N/A SAMM SERVOS NOT INST.	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
06-08		01-54				06-0098		EQUIPMENT AND FURNISHING - HOIST HOOKS				X	I		1		ASB	SS FR-AD 2004-046	NA DUE TO INSTALLATION MISSING	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		01-55	2			08-0214-E		EMERGENCY FLOTATION GEAR, MAXIMUM OPERATING WEIGHT				X	I		1		ASB		NOT INSTALLED, SB REPLACED WITH SB 01.00.59		26-10-2016	HELIAIR, SE.MG.0064	
05-02		01-56	1			05-2241		04-170R1	HOIST HOOKS				X	I		1		ASB		NA, NOT INSTALLED		26-10-2016	HELIAIR, SE.MG.0064
		01-57				06-0337		APC 200 AMP STARTER- GENERATOR LIMITATIONS				X	I		1		ASB		N/A DUE TO MODEL	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
07-05		01-58	1			07-0141-E	2010-22-08	ROTOR FLIGHT CONTROLS - MAIN & TAIL ROTORS SERVO - CONTROLS - INSPECTION / REPLACEMENT				X	I		1		ASB	PN: SC5083-/5084-, SC5072	NA, DUE TO P/N AND TYPE SERVOS INST.	164/11	19-6-2011	Thierry D. Bigara A&P 2541811IA	

REG	MODEL	A-TCDS	TCDS	SN	YEAR	MANDATORY SERVICE BULLETINES & ADS										MRF	JVK-2018-04	SIGN:	CAMO	HNAB, SE.MG.0092			
SE-JVK	AS350BA	R.008	6	1922	1986	AIRFRAME "ASB" ADS										PAGE	of	Update EASA:	BW 2019-04	CAT = ASB-SB-TB		Date:	22-11 2018
Date	ATA	SB	Rev	EASA	FAA-AD	FR-AD	MOD	ACTION				BA	PART	REP	F.DUE	D. DATE	CAT	REMARK	ACTION TAKEN	W.O.	DATE	MECH	
08-12		01-59		08-0214-E				EMERGENCY FLOTATION GEAR - AERAZUR- LH SIDE CONTAINER PN 158170 OR 158210-1 & RH 158171 OR 158215-1				X	I		1		ASB	SS FR-AD 2004-085, SS EASA AD 2006-0248	NA, HAS AIR CRUIZERS STC # SH2825SW FLOATS INST.	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		01-63						CALL BACK OF "CAST" D LOCK HOOKS				X	I		1		ASB		N/A HOIST NOT INST.	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
15-09	65	01-70	1	15-0195			9017	LIMITATIONS - Tail rotor drive, Tail rotor drive shaft bearings, (MP/N) 593404 (P/N 704A33-651-181).				X	I		1		ASB	CW WITH NEW BRGS CANCELS THE ASB-05-00-08	C.W NEW BRGS MPN: 593404 AT 600 HRS INSP. INCORP IN PUBLICATION	HNAB-JVK-18-003	2018-09-26	SE-MG.0092, ARS-3 LGD	
		05-01	*		78-193-001R1	6513-8515		TAIL ROTOR				X	I		1		ASB		P.C.W BY MFG 1-7-86	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		05-02	*		78-193-001R1	6510-6512-5524		TAIL ROTOR PITCH CHANGE LINK PLAY				X	I		1		ASB		P.C.W BY MFG 1-7-86	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		05-03	*		80-14-15	79-104-006		FLANGE INSPECTION				X	I		1		ASB		P.C.W BY MFG 1-7-86	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		05-04	1	*		80-184-015r1		MONITORING OF BOLTS SECURING STAR FLEX STAR TO MR SHAFT, PN 350A37-1202-20 AND -1224-20				X	I		1		ASB		NA DUE TO PN INSTALLED	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		05-05						SURVELLIANCE OF WEAR ON THE MGB VERTICAL SHAFT SPLINES				X	I		1		ASB		REPLACED WITH SB 05.00.06	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		05-06	*		81-09-06	81-094-018r2	7027-7042	NITRIDED STEEL VERTICAL SHAFT PN 350A32-3107-23, OR RETROFIT SOLUTION PN 350A32-3107-24				X	I		1		ASB	C.W SB TELEX 05-05	N/A BY P/N	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		05-07						VERTICAL FIN SPAR (SEE S.B. 05-09)				X	I		1		ASB		P.C.W BY MFG 1-7-86	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
15-09		05-08	6	15-0195	82-20-05	98-173-073	9017	CHECKING THE BALL BRG IN T/R DRIVE SHAFT REAR SECTION BRG MOUNTINGS, SS FRENCH 98-173-073				X	I		1		ASB	SS BY ASB NO: 01.00.70	P.C.W WITH NEW BRGS MPN: 593404 INST. CW GREASING EACH 100 HRS IF NEEDED		26-10-2016	HELIAIR SE.MG.0064	
		05-09	*		82-098-026	1047		CHECKING THE UPPER FIN ATTACHMENT FITTING				X	I		1		ASB	REF SB 55-03	P.C.W BY MFG 1-7-86	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		05-10	1	*	85-068-038	7082, 7083, 7098		SELECTION OF ELLIPTICAL NUT/SPECIAL LOCK PLATE, BEVEL RED UNIT PN 350A32-0300-00/-01/-02				X	I		1		ASB		N/A DUE TO P/N	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		05-11.25	5	*	84-064-037r3			TAIL ROTOR BLADE INSP, ALL				X	I		1		ASB	30 HRS INSP	INCORP. IN PUBLICATION REF MSM REV 6 2017-04-10, + MP	HNAB CAMO	2017-08-21	SE-MG.0092, ARS-3 LGD	
03-04		05-12	*		82-175-029	1211-0720		MONITORING MGB OIL, TEDECO MAGNETIC PLUG PN B4439				X	I		1		ASB	REF SB 65-20	N/A BY AMS 07-1211	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		05-13	3	*	83-07-05R3	83-173-036		MAIN ROTOR MAST SHAFT MONITORING, PN 350A37-1076-00 TO -06				X	I		1		ASB		NA, DUE TO P/N	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		05-14	*		83-169-035			AIRCRAFT EQUIPPED WITH SLIDING DOORS PN 350A25-0030-00 AND -01				X	I		1		ASB		N/A SLIDNG DOORS NOT INST.	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		05-15	1	*	85-095-040			MAIN ROTOR SHAFT PN 350A37-1076-00/-06				X	I		1		ASB		NA, DUE TO P/N	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		05-16			2001-04-14			FUSELAGE TO TAILBOOM INTERFACE FRAME				X	I		1		ASB		THIS SB IS NOW INCORP. IN MSR	WS-35551	16-8-2010	HELIAIR U.K.145.00568	
		05-17	1			1447		CHECKING THE MGB AND ENGINE COWLING "DZUS " FASTENERS				X	I		1		ASB		FOUND P.C.W	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		05-18			8535			SURFACE IMPROVED TGB PITCH CTR LEVER ATTACHMENT YOKES- TGB CASING 350A33-1090-00				X	I		1		ASB	400 HRS INSP	P.C.W IN MSR	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		05-19						MONITORING M/R PITCH CHANGE CONTROL ROD END FITTINGS				X	I		1		ASB		N/A DUE TO TYPE OF BEARING INST.	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
03-04		05-21	1			5057 OR 5058		MR BLADE BONDING OF STAINLESS STEEL L.E, PN350A11-0010-ALL & 355A11-0020- ALL				X	I		1		ASB	PRE MOD 200HRS POST 400 HRS INSP	NA DUE TO BLADE PN INSTALLED (INCORP MET INSP)	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	

REG	MODEL	A-TCDS	TCDS	SN	YEAR	MANDATORY SERVICE BULLETINES & ADS										MRF	JVK-2018-04	SIGN:	CAMO	HNAB, SE.MG.0092			
SE-JVK	AS350BA	R.008	6	1922	1986	AIRFRAME "ASB" ADS										PAGE	of	Update EASA:	BW 2019-04	CAT = ASB-SB-TB		Date:	22-11 2018
Date	ATA	SB	Rev	EASA	FAA-AD	FR-AD	MOD	ACTION				BA	PART	REP	F.DUE	D. DATE	CAT	REMARK	ACTION TAKEN	W.O.	DATE	MECH	
01-09		05-22	1					CAL. TIME LIMIT FOR DYNAMIC SYSTEMS				X	I		1		ASB	6Y/4Y	C.W 12 YEARS' UPDATE IN AC STATUS LISTC .CW (INCORP MET INSP)	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
		05-23						TRH MONITORING PITCH - CHANGE LEVER AND YOKES				X	I				TB	OP-Choice, C.W INSP REF C-1 -a)					
		05-24				9552		POWERPLANT / MGB DRIVE SHAFT				X	I		1		ASB		P.C.W MOD INCORP	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
03-04		05-25	1	*		93-090-067r1	2573, 2582	SLIDING WINDOWS AND DOORS				X	I	BFF	1		ASB	BFF INSP	C.W INSP. EACH BFF AND 100 HRS INSP	SE-JVK-18-004			
16-09	65	05-27	1				6187-6188	TIME LIMITS TGB/TAIL ROTOR BLADE HORN				X	I				SB		INCORP. IN PUBLICATION REF MSM REV 6 2017-04-10	HNAB CAMO	2017-08-21	SE-MG.0092, ARS-3 LGD	
		05-28		*	2000-25-08	96-156-071r1	2720	CHECK MGB SUSPENSION BI-DIRECTIONAL CROSS BEAM, PN 350A38-1018-ALL				X	I		1		ASB	REF SB 63-07	P.C.W SEE RECURRING TIME SHEET FOR NEXT DUE TIME UNDER AD2000-25-08	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
01-05		05-29	3	*		99-085-076r3	6551	TIME LIMITS MAINTENANCE CHECKS, T/R HUB PITCH CHANGE SPIDER PLATE BRG CHECK				X	I		1		ASB	C.W SB 65.38 NEW TYPE BRG 00-7-31	N/A DUE TO P/N	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		05-31	1				3012	CHECK OF UPPER AND LWR FIN ATTACHMENT SCREWS AND SPAR FITTING				X	I		1		ASB	NEW TYPE OF BOLTS	P.C.W MOD, INSP NA (INCORP MET INSP)	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
		05-32					6201, 6202	CORROSION CHECK AT LWR BRG. OF MAIN ROTOR SHAFT, PN 350A37-1076-00 TO -12 AND -1290-00 TO -05				X	I				TB	6 YRS BETWEEN TWO INSP	C.W AC 11 HRS 1112.7 AT MGB EXCHANGE, INCORP IN ASL, (INCORP MET INSP)	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
04-03		05-33	1	*	2001-17-32	00-222-079r1	6554	CHECK T/R PITCH CHANGE PLATE BEARING SPACER, CHECK BLACK PAINT SLIP MARK				X	I		1		ASB		INCORP MET INSP APPLICABLE, DUE TO COMPLIANCE WITH AMS 07-654	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		05-36					3029	CHECK FOR ABSENCE OF PLAY IN THE PILOT/COPILOT WINDSHIELD WIPER ARM ATTACHMENT				X	I		1		ASB	PERFORM PARA 2.B.2 & 2.B.3	NA NEW TYPE OF SHAFT INSTL.	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
04-11		05-37	2	*		01-580-085r2	3139	T/R SERVO; CHECK ROD END LOCKING DEVICE				X	I		1		ASB	MOD SB 67.22	N/A SB67.00.22 INCORP. (INCORP MET INSP)	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
02-06		05-38	2	*	2002-03-52	01-557-086r3	6221	MRH STARFLEX: SEPARATION OF THE BUSH FROM THE STARFLEX STAR ARM END, PN 350A33-1916-00				X	I		1		ASB	ALF	NA BY PN INSTALLED	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
09-02		05-40	3	09-0039	2001-26-55		CN453	T/R BLADE SKIN CRACK INSP. PN 355A12-0031-01 UP TO -14, 355A12-0040-00 UP TO -08, 355A12-0050-04				X	I		1		ASB	ALF INSP INCORP IN PRE SS EASA AD 2007-0138E	NA BY PN OF TR INSTALLED (INCORP MET INSP)	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
07-01		05-41	1	06-0249	2003-02-05			SLIDING DOOR, CHECK OF THE SLIDING DOOR AFT GUIDE ROLLER AND MIDDLE RAIL				X	I		1		ASB	FR AD 2002-344-093R1, MOD SB 52.00.29 100 HRS INSP	NA SLIDING DOORS NOT INSTALLED, (INCORP MET INSP)	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
04-03		05-42					07-3215	TIME LIMITS - MAINTENANCE CHECKS - CHECK AND REPAIR OF THE BUCKETS OF PILOT AND COPILOT SEAT				X	I	100			TB	PN 350A77-0068-01	C.W INSP REF 2.B.1	SE-JVK-18-004			
04-05		05-43	1	*	2007-12-22	04-035	07-3215	TIME LIMITS - MAINTENANCE CHECKS - TAILBOOM STRUCTURE JUNCTION FRAME INSP. REF 53.10.22.772				X	I		1		ASB	2.B.1.A AT 2700 HRS, 2.B.1.B. EVERY 550 HRS	C.W MOD AT AC 12 YEARS INSP AC TT 1112.7 HRS, (INCORP MET INSP)	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
04-06		05-45	1	*		04-055		TIME LIMITS - MAINTENANCE CHECKS - REPLACEMENT OF HYDRAULIC FLUID IN COLD WEATHER				X	I		1		ASB	BEFORE FLYING IN COLD WEATHER, -15 Deg C	C.W EACH 30 DAYS IN WINTER CLIMATE USE FLUID 31, (INCORP MET INSP)	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
04-12		05-46		09-0030				STABILIZERS - UPPER AND LOWER FIN SPARS				X	I		1		ASB	SS FR-AD 2005-010, SS EASA 2006-0095	SB & AD SUPERSEDED BY SB 55.16 AD 2009-0030	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
07-08		05-47	1	07-0236	2013-08-19			DOORS - PIN OF THE SLIDING DOOR REAR FITTING				X	I		1		ASB	MOD IAW SB 52.00.30r1, SUPERSEDES 06-0251R2	NA SLIDING DOORS NOT INSTALLED	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
05-08		05-48		06-0273		05-102r1		BLADE OF THE RH CABIN VIBRATION DAMPER - TIME LIMITS-MAINTENANCE CHECKS				X	I		1		ASB	SS FR-AD 2005-102R1	NA AUTO PILOT NOT INSTALLED	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
07-01		05-51		06-0055-E	2006-19-01		3343 3191	CRACKED MAIN SERVO CONTROL TAPERED HOUSING				X	I		1		ASB	C.W PARA 2.B.3	NY BY PN INSTALLED	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
14-05	55	05-53						CHECK OF UPPER AND LWR FIN ATTACHMENT SCREWS AND SPAR FITTING				X	I				SB	600 HRS INSP.,	INCORP. IN PUBLICATION REF MSM REV 6 2017-04-10	HNAB CAMO	2017-08-21	SE-MG.0092, ARS-3 LGD	
		05-54		06-0286	2007-26-11			OXYGEN CYLINDERS				X	I		1		ASB	NA TO BA MODELS	NA NOT FITTED TO AC	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	

REG	MODEL	A-TCDS	TCDS	SN	YEAR	MANDATORY SERVICE BULLETINES & ADS							MRF	JVK-2018-04	SIGN:	CAMO	HNAB, SE.MG.0092		
SE-JVK	AS350BA	R.008	6	1922	1986	AIRFRAME "ASB" ADS					PAGE	of	Update EASA:	BW 2019-04	CAT = ASB-SB-TB		Date:	22-11 2018	
Date	ATA	SB	Rev	EASA	FAA-AD	FR-AD	MOD	ACTION	BA	PART	REP	F.DUE	D. DATE	CAT	REMARK	ACTION TAKEN	W.O.	DATE	MECH
07-08		05-55	2					CRACK IN THE BELT BUCKLE, PACIFIC SCIENTIFIC LAP.	X	I		1		ASB		NA DUE TO TYPE INSTALLED		26-10-2016	HELIAIR SE.MG.0064
09-02		05-58		2009-0019			3175 - 3237	COLLECTIVE PITCH LEVER LOCKING STUD	X	I	600	1		ASB	IF C.W SB 67.00.37, 600 HRS INSP	C.W EACH ADJUSTMENT,	SE-JVK-18-004		
14-10	67	05-59	1				3466	FUSELAGE, Visual Check for Cracks in the Lower Crossbeams of the Yaw Control Bellcrank Support, PRE MOD 073466.	X	I				SB	INCORPORATED IN MSM-ASL	INCORP. IN PUBLICATION REF MSM REV 6 2017-04-10	HNAB CAMO	2017-08-21	SE-MG.0092, ARS-3 LGD
09-12		05-60		10-0006	2011-22-05			T/R PITCH LINKS - CHECK FOR NO PLAY IN THE T/R PITCH CHANGE LINKS	X	I		1		ASB	30 HRS INSP & ALF PILOT CHECK	C.W INSP INCORP IN ALF CHECK LIST	HNAB-JVK-18-003	2018-09-26	SE-MG.0092, ARS-3 LGD
11-03		05-62	2	11-0038-E	2014-05-07			TIME LIMITS - MAINTENANCE CHECKS - PERIODIC INSPECTION OF THE TGB CONTROL LEVER	X	I		1		ASB	ONE TIME IF MODIFIED MARKED X, SS 2010-11-51	P.C.W MOD I.A.W Para 2.B.3.b REWORK OF the CONTROL LEVER PERE BY NAMP	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
11-04		05-63	1	11-0072	2012-25-01			AERAZUR - EMERGENCY FLOATATION GEAR ATTACHMENT BRACKETS - INSP./REPL.	X	I		1		ASB	SS AD 2010-0082-E	NA NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
11-08		05-64	2	11-0164	2013-17-01			CHECKING THE LOCKING OF THE STOP SCREWS OF THE YAW FLIGHT CONTROLS	X	I		1		ASB	AUTO PILOT ONLY	NA DUE TO VERSION		26-10-2016	HELIAIR SE.MG.0064
14-11		05-66	2	13-0281R1			3274	LIGHTS- POSITION STROBE LIGHT - INSPECTION DEACTIVATION, GRIMES HONEYWELL PN : 60-1431-3	X	I		1		ASB	SS AD 2011-0244-E	NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
14-10	53	05-67	1					Inspection of the longitudinal bulkheads	X	I		1		ASB	INCORPORATED IN MSM-ASL	INCORP. IN PUBLICATION REF MSM REV 6 2017-04-10	HNAB CAMO	2017-08-21	SE-MG.0092, ARS-3 LGD
		05-68						SKURKA (APC) STARTER-GEN MP/N : 150SG122Q & 200SGL130Q	X	I		1		ASB		C.W (INCORP MET INSP)	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
14-03	53	05-70		14-076R1	2016-05-06		3232	TIME LIMITS - MM CHECKS, Rear structure - Check of the rear frame reinforcement angles. (P/N) 350A08.2493.21 or P/N 350A08.2493.23,	X	I		1		ASB	P.C.W. 3.B.1, Insp each 165 HRS	C.W PARA 3.B.2, INCORPORATED IN FP-MP350 CHAP 3, & ASL	HNAB-JVK-18-003	2018-09-26	SE-MG.0092, ARS-3 LGD
12-12		05-71	2	12-0257-E			07-5601	TAIL ROTOR LAMINATED HALF BEARINGS -INSPECTION/ REPLACEMENT	X	I		1		ASB	10 HRS INSP & ALF PILOT CHECK	C.W INSP EACH 10 HRS IAW 3.B. 1, INCORP IN MP ALF CHECK LIST	HNAB CAMO	2017-08-21	SE-MG.0092, ARS-3 LGD
14-07		05-72	4	14-0233			07-9566	TIME LIMITS - MM CHECKS - ENGINE-TO-MGB COUPLING HYD PUMP DRIVE CHECK. SS EASA AD 2013-0044, 2013-0284R1	X	I		1		ASB	PRE MOD OP-3346 /3082 & POST MOD 07-9566 SB 29.15	NA DUE TO PRE MOD 07-9566		26-10-2016	HELIAIR SE.MG.0064
16-02		05-74	2	13-0133CN	2015-17-01			CHECK THAT THERE ARE NO CRACKS ON THE INNER YOKE OF THE TWO PITCH HORNS. PN: 350A12-1368-01/-02/-03/-04, EASA AD 2013-0133 CANCELLED	X	I		1		ASB	MODIFIED YOKE 350A12-1368-04, 165 HRS INSP	C.W INSP. ON INSTL YOKE PN: 350A12.1368.03 PARA 3.B, INCORP. IN ASI FOR FOLLOW UP	MAC 13-052	25-6-2013	MAC SE.145.0113 NE AT-17
13-04	72	05-75						ENGINE STARTING - Starter control, Periodic adjustment and check of the tensioning of the SKURKA (ex APC) starter-gen damper system	X	I				SB	150SG122Q & 200SGL130Q SB150SG155 & SB200SG156	NA DUE TO VERSION INSTALLED IS AUXLIC 524-031	HNAB CAMO	2017-08-21	SE-MG.0092, ARS-3 LGD
14-01	28	05-76						TIME LIMITS - MAINTENANCE CHECKS - Fuel Tank Draining, Check of the condition of the drain control cable	X	I				SB	INCORPORATED IN MSM-ASL	INCORP. IN PUBLICATION REF MSM REV 6 2017-04-10	HNAB CAMO	2017-08-21	SE-MG.0092, ARS-3 LGD
13-12	53	05-78						FUSELAGE - BOTTOM STRUCTURE, CHECK OF THE FRONT LOWER PART OF THE BOTTOM STRUCTURE (X970-Y400)	X	I		1		SB	INCORPORATED IN MSM-ASL	INSP PERF AC TT: 1681,1 HRS, SB INCORP. IN PUBLICATION REF MSM REV 6 2017-04-10	SAT WO	2016-12-12	SAT SE.145.0089
16-10	73	05-83	1				07-4765 - 4293 SB 21-18/24	Periodic check for corrosion on the pipes of the P2 air heating/demisting system	X	I	165H/13M	1		SB		C.W INSP 3.B.2 AND 3.B.3 UNTIL MOD IS INCORP.	SE-JVK-18-004		
15-05	63	05-84		15-0094	2016-25-20			Main Rotor Drive – Cross-Bar – Inspection, (P/N) 350A38-1040-20 or P/N 350A38-1040-00,	X	I		1		ASB	INTV TIME LIMITS: 4500 FH or 60 000 TC	C.W PARA 3, NEXT GEARBOX REM. 26-10-2016, HELIAIR SE.MG.0064, INCORP. FOLLOW UP IN ASI		2018-03-01	SE-MG.0092, ARS-3 LGD
17-01	64	05-86		17-0020-E			5601- 6602	Periodic check of the Tail Rotor Hub (TRH) pitch change rod	X	I		1		ASB	Helicopters which embody MOD 075601 or 076602, Elastomeric Bearing	NA DUE TO MOD STATUS		26-10-2016	HELIAIR SE.MG.0064
17-06	24	05-88		17-0109				Electrical Power – Starter Generator and Brushes – Inspection; SKURKA (MP/N) 150SG122Q-4.	X	I		1		ASB		NA DUE TO VERSION INSTALLED IS AUXLIC 524-031	HNAB CAMO	2017-08-21	SE-MG.0092, ARS-3 LGD
18-07	53	05-92		2018-0152				Fuselage – Check for the presence of the Main Gear Box (MGB) suspension bar attachment bracket screw head	X	I	1	1		ASB		C.W. PARA 3, INSPECTION	SE-JVK-18-004		
		21-06	1					HEATING AND DEMISTING SYSTEM, WITH TWIN SEAT INSTALLATION	X	I				TB	OPTIONAL INSTL Operator's initiative.				

REG	MODEL	A-TCDS	TCDS	SN	YEAR	MANDATORY SERVICE BULLETINES & ADS										MRF	JVK-2018-04	SIGN:	CAMO	HNAB, SE.MG.0092			
SE-JVK	AS350BA	R.008	6	1922	1986	AIRFRAME "ASB" ADS										PAGE	of	Update EASA:	BW 2019-04	CAT = ASB-SB-TB		Date:	22-11 2018
Date	ATA	SB	Rev	EASA	FAA-AD	FR-AD	MOD	ACTION				BA	PART	REP	F.DUE	D. DATE	CAT	REMARK	ACTION TAKEN		W.O.	DATE	MECH
		22-06						AUTO FLIGHT - MOVEMENT CONTROL				X	I				TB	OPTIONAL INSTL. Operator's initiative.	NA DUE TO AUTOPILOT IS NOT INSTALLED			26-10-2016	HELIAIR SE.MG.0064
		23-02					2286	MODIFICATION INSTALLATION ANTENNA				X	I		1		ASB		NA, ANTENNA NOT INSTALLED		MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
15-09	23	23-06	1				4715	COMMUNICATION - VHF ANTENNA SEALING				X	I				SB	OPTIONAL INSTL. Operator's initiative.					
		24-01						MASTER BOX MOD				X	I		1		ASB		C.W. MOD AT AC 12 YEARS INSP AC TT 1112,7 HRS		10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		24-02						BATTERY TEMPERATURE PROBE				X	I		1		ASB	REF SB 01-29	NA DUE TO BATTERY TYPE INSTALLED		MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
		24-03	2				1686-1969	ELECTRICAL MASTER BOX OVERVOLTAGE PROTECTION				X	I				TB	BA, B2 CONVERSION	C.W. MOD AT AC 12 YEARS INSP AC TT 1112,7 HRS		10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
03-06		24-10	*			03-260R1	3226	ELECTRICAL POWER - CHECKING THE INSTALLATION OF THE BATTERY LUG CONNECTION				X	I		1		ASB		NA DUE TO BATTERY TYPE INSTALLED		10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		24-12						ELECTRICAL POWER - CORRECT INSTASLLATION OF REGULATOR CAPACITORS IN ELECTRICAL MASTER BOX				X	I				TB	OPTIONAL INSTL. Operator's initiative.					
16-06	24	24-26	1				4692	ELECTRICAL POWER - Starter-generator - Improved SKURKA starter-generator. (MP/N) 150SG122Q.				X	I				SB	(MP/N) 150SG122Q-4 is Increased from 900h To 1200h	NA DUE TO TYPE INSTALLED IS AUXILIC		HNAB CAMO	2017-08-21	SE-MG.0092, ARS-3 LGD
17-05	24	24-31		17-066			4838	Replacement of a power cable belonging to very cold weather starting optional equipment				X	I		1		ASB	OPTIONAL INSTL	NA, NOT INSTALLED		HNAB CAMO	2017-08-21	SE-MG.0092, ARS-3 LGD
18-10	24	24-31	1	2017-0143			4838	Electrical Power - Direct Current Second Battery. Replacement of a power cable belonging to very cold weather starting optional equipment				X	I		1		ASB	OPTIONAL INSTL	NA DUE TO TYPE OF BATTERY INSTALLED IN AC		HNAB CAMO	2018-11-22	SE-MG.0092, ARS-3 LGD
08-10		25-01.02		08-0189	2012-26-07			EMERGENCY FLOTATION GEAR - AERAZUR- CONTAINER REPLACEMENT				X	I		1		ASB		NA, NOT INSTALLED		MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
16-06	25	25-01.87					4614	Replacement of cargo swing load indicator further to obsolescence				X	I				SB	OPTIONAL INSTL. Operator's initiative.					
15-01	25	25-02-24						EQUIPMENT AND FURNISHINGS - Medical installation: lower stretcher				X	I				SB	OPTIONAL INSTL. Operator's initiative.					
14-12	25	25-03	7					AEROMEDICAL INST, FIXED PARTS				X	I				SB		SB CANCELLED		HNAB CAMO	2017-08-21	SE-MG.0092, ARS-3 LGD
		25-04						INSTALLATION OF PROVISIONS AND FIXED PARTS FOR CARGO SLING				X	I		1		ASB		NA, BY TYPE OF KIT INSTALLED		MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
		25-05						INSTALLATION OF PROVISIONS TO RELEASE ELECTRIC CARGO SLING				X	I		1		ASB		NA, BY TYPE OF KIT INSTALLED		MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
		25-06					6055-6090-6070-6088-6078-6144	HUB/MAST REINFORCED ATTACHMENT BOLTS				X	I				TB		C.W				
		25-09						EMERGENCY FLOTATION GEAR - AERAZUR- REMOVAL OF PARTS				X	I		1		ASB		NA, NOT INSTALLED		MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
		25-13						PROVISIONS FOR AND FIXED PARTS FOR CARGO SWING 906 KG				X	I				TB		C.W				
		25-19	*			81-067-016	0890	INCREASED TRAVEL MECHANICAL CONTROL				X	I		1		ASB	SWING HOOK INSTL	NA, BY TYPE OF KIT INSTALLED		MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
		25-24	3				1403, 1414, 1455, 1458	HIGH AND LOW BACK BUCKET SEATS				X	I				SB		C.W. MOD				
02-11		25-29					OP1475-OP1476	OUTSIDE PANORAMIC REAR VIEW MIRROR				X	I				TB	OPTIONAL INSTL. Operator's initiative.					

REG	MODEL	A-TCDS	TCDS	SN	YEAR	MANDATORY SERVICE BULLETINES & ADS										MRF	JVK-2018-04	SIGN:	CAMO	HNAB, SE.MG.0092			
SE-JVK	AS350BA	R.008	6	1922	1986	AIRFRAME "ASB" ADS										PAGE	of	Update EASA:	BW 2019-04	CAT = ASB-SB-TB		Date:	22-11 2018
Date	ATA	SB	Rev	EASA	FAA-AD	FR-AD	MOD	ACTION				BA	PART	REP	F.DUE	D. DATE	CAT	REMARK	ACTION TAKEN	W.O.	DATE	MECH	
		25-31						IMPROVEMENT OF THE CARGO SWING EMERGENCY MANUAL CONTROL				X	I		1		ASB	SWING HOOK INSTL	NA DUE TO PN HOOK INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
		25-32						ELECTRICAL CONTROL CIRCUIT FOR CARGO SLING AND CARGO SWING JETTISONING				X	I		1		ASB	INCORPORATED IN MSM-ASL	INCCORP. IN PUBLICATION REF MSM REV 6 2017-04-10	HNAB CAMO	2017-08-21	SE-MG.0092, ARS-3 LGD	
		25-34						CABLE CUTTER INSTALLATION				X	I		1		ASB		C.W INSP	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
		25-35						AERAZUR HELIUM EMERGENCY FLOTATION GEAR				X	I				TB		NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
		25-36						FIRST AID KIT + EMERGENCY AXE INSTALLATION				X	I				TB		NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
		25-37						DEFINITION OF A GLASS CLOTH HIGH BACK SEAT ASSY AND A SHOULDER HARNESS SYSTEM				X	I		1		ASB		P.C.W HIGH REST SEATS	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
02-06		25-38	4				1940-1983- 1984-2655	INSTL. OF FWD TWO-PLACE BENCH SEAT (HIGH BACKREST) ON COPILOT SEAT				X	I				TB		NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
		25-40						MAP HOLDER NET ON PILOTS SEAT				X	I				TB		NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
		25-41						SHERMULLY FLARE INSTALLATION				X	I		1		ASB		NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
		25-42	1	*			91-165- 058R1	2457, 2450	BONDING ELEC. HOIST LUCAS AIR				X	I		1		ASB	AD 91-125, ta bort detta nummer om den inte finns	NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
		25-44	1					INSPECT CRIMPING CONNECTOR FLOAT CYLINDER				X	I		1		ASB		NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
		25-45		*			92-144-061	2492R1	SUB MARINE BEACON				X	I		1		ASB		NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
		25-46						HOIST				X	I		1		ASB		NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
		25-49						GA FLOATING				X	I		1		ASB		NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
		25-56						MECHANICAL RELEASE CONTROL UNIT (SLING INSTAL.)				X	I				TB	PN AS 22-09-20, INDRAERO SIREN	NA DUE TO PN HOOK INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
02-07		25-59	1				08-4182	CABIN FLOOR WINDOW INSTALLATION				X	I				TB		C.W DART WINDOW INSTALLATION	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
02-03		25-63	2				2832	REINFORCEMENT OF COPILOT/PILOT SEAT INSTALLATION, C.W DRAWING 350A08-306900				X	I				TB	OPTIONAL INSTL. Operator's initiative.					
01-07		25-69					2820	ROUTING OF CARGO SWING INSTAL. MECH. EMERGENCY LOAD RELEASE UNIT CTR. CABLE				X	I				TB	OPTIONAL INSTL	NA DUE TO PN HOOK INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
08-02		25-70		08-0044			3166	EQUIPMENT/FURNISHING - REAR BENCH SEAT AND SLIDING DOORS- LIMITATION/REMOVAL/MODIFICATION				X	I		1		ASB	OPTIONAL INSTL, INSTAL DECAL WITH RESTRICTION	NA SLIDING DOOR NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
02-06		25-71					3026	INSTALLATION OF EMERGENCY FLOTATION GEAR LIGHT WEIGHT CYLINDERS				X	I				TB	OPTIONAL INSTL	NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
02-02		25-73		*			02-027-088r1	INSTALLATION OF EC120 HANDLES ON ECUREUIL CANOPY POST				X	I		1		ASB	B3 ONLY	NA DUE TO VERSION	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
03-07		25-77					08-5004	KANNAD 406-AF-H EMERGENCY LOCATOR TRANSMITTER INSTALLATION				X	I				TB	B3 ONLY	NA DUE TO VERSION	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
02-12		25-79		*	2003-25-01	02-585	3190	ELECTRIC HOIST INSTALLATION				X	I		1		ASB		NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	

REG	MODEL	A-TCDS	TCDS	SN	YEAR	MANDATORY SERVICE BULLETINES & ADS										MRF	JVK-2018-04	SIGN:	CAMO	HNAB, SE.MG.0092			
SE-JVK	AS350BA	R.008	6	1922	1986	AIRFRAME "ASB" ADS										PAGE	of	Update EASA:	BW 2019-04	CAT = ASB-SB-TB		Date:	22-11 2018
Date	ATA	SB	Rev	EASA	FAA-AD	FR-AD	MOD	ACTION				BA	PART	REP	F.DUE	D. DATE	CAT	REMARK	ACTION TAKEN	W.O.	DATE	MECH	
03-08		25-80						EQUIPMENT AND FURNISHINGS: CARGO SLING LONG LINE INSTALLATION (FIXED PARTS)				X	I				TB	B3 ONLY	NA DUE TO VERSION	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
03-08		25-89		10-0014				HOIST OPERATORS BELT SNAP HOOK - REPLACEMENT / MODIFICATION				X	I		1		ASB	SS FR-AD 2004-096	NA HOIST NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
06-09		25-94		05-4691			3318	GOODRICH ELECTRICAL HOIST				X	I		1		ASB		NA, NOT INSTALLED	HNAB CAMO	2017-08-21	SE-MG.0092, ARS-3 LGD	
06-09		25-95		06-0164	2010-09-01		3318	GOODRICH ELECTRICAL HOIST				X	I		1		ASB	SS FR-AD 2005-087	NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
		28-02					0289	FUEL TANK WITH LOW RESIDUAL FUEL QUANTITY, C.W INSTAL NEW TYPE OF TANK				X	I				TB	OPTIONAL INSTL. Operator's initiative.					
		28-04	1				1078	FITTING OF A FLOWMETER ON ARRIEL FUEL SUPPLY SYSTEM				X	I				TB		NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
		28-05	*			82-158-027	1096	FUEL FILTER BY PASS IND INSTALLATION				X	I		1		ASB		C.W INCORP AT PRODUCTION	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		28-06	1 *			85-112-041	1624	ENLARGEMENT OF THE FUEL FILTER DRAIN FEEDTHROUGH HOLE				X	I		1		ASB		C.W INCORP AT PRODUCTION	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		28-07	1 *			86-077-046R2	1461-1668-1671	NEW FILTER WITH DIFFERENTIAL PRESSURE SWITCH				X	I		1		ASB		C.W INCORP AT PRODUCTION	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		28-08	*			86-097-047	1671	FUEL FILTER LE BOZEC ET GAUTHIER				X	I		1		ASB		C.W INCORP AT PRODUCTION	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		28-09	2				OP1760	FUEL ANTI ICING SYSTEM				X	I				TB		NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
15-04	28	28-10	1				1842-2663	LOW PRESSURE FUEL PUMP FAILURE WARNING				X	I				SB	OPTIONAL INSTL. Operator's initiative.					
		28-12	2				2484	MOD. TO CAPACITOR FUEL GAUGE SYSTEM				X	I				TB	OPTIONAL INSTL. Operator's initiative.	C.W AT BA MOD	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		28-13					2671	FUEL DRAINAGE RECOVERY-ARRIEL ENGINE				X	I				TB	OPTIONAL INSTL	P.C.W	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
00-07		28-14	*	2002-20-03	00-302(A)			FERRY TANK GROUNDING				X	I		1		ASB	BEFORE FLIGHT WITH FERRY TANK INSTL	NA, NOT INSTALLED	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
04-05		28-16	*	2005-03-08	04-033	3239		FUEL - IN FLIGHT LOSS OF FUEL BLEED LEVER				X	I		1		ASB	PN 350A55-1043-20	P.C.W	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
04-05		28-21		2005-03-08				INTEGRATION OF A RELAY IN THE FUEL PUMP CONTROL UNIT				X	I				TB	OPTIONAL INSTL. Operator's initiative.	P.C.W	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		29-02	2				1778	REGULATION HYDRAULIC PRESSURE				X	I				TB	OPTIONAL INSTL. Operator's initiative.					
02-07		29-03					2082-OP1909	INSTALLATION OF A HYDRAULIC GROUND POWER CONNECTOR				X	I				TB	OPTIONAL INSTL. Operator's initiative.					
04-04		29-04	1		2007-06-25	9547		HYDRAULIC POWER- LUBRICATION OF THE SPLINES ON THE HYDRULIC PUMP DRIVE SHAFT				X	I				TB	INCORP IN MET, NEXT REVISION, 110 HRS INSP	C.W GREASING, INCORP IN MET, NEXT REV. IN MSM	MAC 13-052	25-6-2013	MAC SE.145.0113 LGD AT-1	
		29-06				2453		HYDRAULIC POWER- NEW TYPE OF FILTER UNIT 3 MICRON WITH CLOGGING INDICATOR				X	I				TB	OPTIONAL INSTL. Operator's initiative.					
04-04		29-07	1 *		04-089	3263		IMPROVEMENT OF THE "HYDRAULIC CUT OFF" FUNCTION				X	I		1		ASB		P.C.W (INCORP MET INSP)	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
04-11		29-08						CHECK TR SERVOCONTROL CUT-OFF SOLENOID VALE WIRING				X	I				TB		NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	

REG	MODEL	A-TCDS	TCDS	SN	YEAR	MANDATORY SERVICE BULLETINES & ADS										MRF	JVK-2018-04	SIGN:	CAMO	HNAB, SE.MG.0092			
SE-JVK	AS350BA	R.008	6	1922	1986	AIRFRAME "ASB" ADS										PAGE	of	Update EASA:	BW 2019-04	CAT = ASB-SB-TB		Date:	22-11-2018
Date	ATA	SB	Rev	EASA	FAA-AD	FR-AD	MOD	ACTION				BA	PART	REP	F.DUE	D. DATE	CAT	REMARK	ACTION TAKEN	W.O.	DATE	MECH	
08-05		29-10						HYDRAULIC POWER- REPLACEMENT OF THE HYDRAULIC HOSES				X	I				SB		C.W MOD AT AC 12 YEARS INSP AC TT 1112,7 HRS. (INCP MET INSP)	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
15-12	29	29-12	2				3317	HYDRAULIC GENERATION - Indication, Indication of the hydraulic failure test				X	I				SB	AIRBUS REC. TO OPERATOR					
		29-13			2012-17-03			HYDRAULIC POWER SYSTEM - SILICON SLEEVE INSTALLATION ON FWD SERVO AT FAN				X	I		1		ASB		C.W MODIFICATION INSTALLATION	164/11	19-6-2011	Thierry D. Bigara A&P 2541811A	
14-03	29	29-15	2				9566	HYDRAULIC POWER - New hydraulic pump drive				X	I				SB	OPTIONAL INSTL. Operator's initiative.					
13-02	29	29-16					4627	HYDRAULIC POWER - MODIFICATION OF RELAY 47D				X	I				SB	OPTIONAL INSTL. Operator's initiative.					
15-05	29	29-18					4688	HYDRAULIC POWER GENERATION - Collective lever, Installation or replacement of relay 47D				X	I				SB	AIRBUS REC. TO OPERATOR					
		30-04					1537	AIR INTAKE : DRAIN HOLE AND REMOVABLE SCREEN				X	I				TB	BA, B2 CONVERSION	C.W				
02-06		30-05	2				0569-0709	ICE AND RAIN PROTECTION				X	I				TB		C.W	192/12	2-8-2012	Thierry D. Bigara A&P 2541811A	
04-06		30-07					3194	ICE AND RAIN PROTECTION - WINDSHIELD WIPER INSTALLATION				X	I				TB	OPTIONAL INSTL. Operator's initiative.					
04-06		30-09						WINDSHIELD WIPERS				X	I				TB	OPTIONAL INSTL. Operator's initiative.					
		31-03						IMPROVED NR (rotor r.p.m) MIN-MAX AURAL WARNING SYSTEM				X	I				TB	OPTIONAL INSTL BA MOD	C.W AT BA MOD	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B	
		31-63						INDICATING AND RECORDING SYSTEMS - Warning unit, Check of the warning unit (MPIN) 704A4723006.				X	I				TB	AIRBUS REC. TO OPERATOR	C.W. CHECK FOR LAMP TOOLS INSTALLED				
		32-03					0860	LENGTHENING OF SKID PROTECTIVE SHOES				X	I				TB	OPTIONAL INSTL. Operator's initiative.					
		32-04						FLOAT BRACKETS				X	I		1		ASB		NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
		32-05	1				1367	HOIST				X	I		1		ASB		NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
		32-06	*				86-030-043	HIGH SKID LANDING GEAR, WITH EMERGENCY FLOATS, STEPS MODIFICATION				X	I		1		ASB	INCPOR IN DOC	NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01	
		32-07					1755	L/G NEW STANDARD FOR AFT FOOTSTEP ON HIGH SKID GEAR				X	I				TB	OPTIONAL INSTL. Operator's initiative.					
		32-08					1806, 1826	ASSEMBLY OF HIGH L/G SHOCK ABSORBERS ATTACH CLAMP				X	I				TB	OPTIONAL INSTL. Operator's initiative.					
		32-09	1				2225	STIFFENING THE SHOCK ABSOBERS, PN 350A75-2050-05				X	I				TB	OPTIONAL INSTL. Operator's initiative.					
15-06	32	32-11	3				3376	LANDING GEAR - L/G skids, Reinforced wear plates for skid L/G				X	I				SB	OPTIONAL INSTL. Operator's initiative.					
		33-10					1471-1737	STROBE LIGHT INSTALLATION ON HORIZONTAL STABILIZER				X	I				TB	OPTIONAL INSTL. Operator's initiative.					
		33-11	2									X	I				TB	OPTIONAL INSTL. Operator's initiative.					
		33-12	1				1849	INSTALLATION OF A RETRACTABLE, SWIVELLING LANDING LIGHT				X	I				TB	OPTIONAL INSTL. Operator's initiative.					

REG	MODEL	A-TCDS	TCDS	SN	YEAR	MANDATORY SERVICE BULLETINES & ADS							MRF	JVK-2018-04	SIGN:	CAMO	HNAB, SE.MG.0092		
SE-JVK	AS350BA	R.008	6	1922	1986	AIRFRAME "ASB" ADS					PAGE	of	Update EASA:	BW 2019-04	CAT = ASB-SB-TB		Date:	22-11 2018	
Date	ATA	SB	Rev	EASA	FAA-AD	FR-AD	MOD	ACTION	BA	PART	REP	F.DUE	D. DATE	CAT	REMARK	ACTION TAKEN	W.O.	DATE	MECH
		33-13		*		02-281-091	1182	INSTRUMENT PANEL AND CONSOLE LIGHTING	X	I		1		ASB	OPTIONAL INSTL	NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
		33-19					2817	RELOCATION THE LANDING LIGHT POWER SUPPLY CIRCUITRY	X	I				TB	CONTINUOUS USE LANDING LIGHT	C.W			
15-03	33	33-22	2				3335	LIGHTS - LED position lights, Helicopters PRE MOD 073335 and POST MOD 073162.	X	I				SB	OPTIONAL INSTL. Operator's initiative.				
15-03	33	33-23	1	13-0281R1			4611	POSITION STROBE LIGHT	X	I				ASB	OPTIONAL INSTL. Operator's initiative.	NA STROBE NOT INSTALLED		26-10-2016	HELIAIR SE.MG.0064
16-04	33	33-40	1				4720	LIGHTING - Outer lighting - Improvement of wiring protection in the stabilizer	X	I		1		SB	AIRBUS REC. TO OPERATOR	C.W			
		34-02					0458-1545-1737	GYRO COMPASS KING KCS 55A-01	X	I				TB		NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
		34-03					0597-0598-0740-1737	INSTALLATION OF A SFENA H140 GYRO HORIZON	X	I				TB		NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
		34-05	1				0698	PITOT STATIC SYSTEM (Total Pressure Head)	X	I				TB	OPTIONAL INSTL. Operator's initiative.				
		34-06					2391	RELOCATION MARKER ANTENNA, MARKER PN KR 21, MKR 350	X	I				TB		NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
		34-08		*		92-093 92-092		GPS NAVIGATION TRIMBLE	X	I		1		ASB	OPTIONAL INSTL	NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
04-05		34-13		*		02-281R1		NAVIGATION, - HORIZONTAL SITUATION INDICATOR KI 525A, PN 066-3046-07	X	I		1		ASB	HSI KI 525A	NA, NOT INSTALLED	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
91-09		39-01	1				1156-1306-1583-1609	ELECTRIC PANELS HONEYWELL, ELECTRIC CONTROL PANEL	X	I				TB	SUPERSEDED BY TB 39.09	C.W			
		39-03					1891	NR MIN ALARM TRIPPING TRESHOLD	X	I				TB	BA, B2 CONVERSION	C.W			
		39-04	1				1966-2239-2385	DETECTING AND WARNING - MINIMUM NR/MAXIMUM NR	X	I				TB	OPTIONAL INSTL. Operator's initiative.				
		39-05						CONNECTION FUZE OF NR/NT INDICATOR	X	I				TB		NA DUE TO VERSION	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
		39-07	3				2524	ELECTRONIC/ELECTRIC PANELS, INSTL OF SIGMATEC 4 DATA PANEL	X	I				TB	BA MOD OPTIONAL	C.W			
96-12		39-09					1156-1306-1583-1609	ELECTRIC PANELS HONEYWELL, ELECTRIC CONTROL PANEL	X	I				TB	BA MOD SUPERSEDES TB 39.01R1	C.W			
		414-65-82					5538	T/R REINFORCED BLADE HORN	X	I		1		ASB	INCORPORATED IN MSM-ASL	INCORP. IN PUBLICATION REF MSM REV 6 2017-04-10	HNAB CAMO	2017-08-21	SE-MG.0092, ARS-3 LGD
		497-63-82					0720	ELECTRICAL CHIP DETECTOR ON MGB & TGB	X	I		1		ASB	INCORPORATED IN MSM-ASL	INCORP. IN PUBLICATION REF MSM REV 6 2017-04-10	HNAB CAMO	2017-08-21	SE-MG.0092, ARS-3 LGD
		52-04		*		79-133-007		CHECKING THE LOCKING DEVICE OF LH SIDE BAGGAGE HOLD DOOR	X	I		1		ASB	INCORPORATED IN MSM-ASL	INCORP. IN PUBLICATION REF MSM REV 6 2017-04-10	HNAB CAMO	2017-08-21	SE-MG.0092, ARS-3 LGD
		52-08						HIGH VISIBILITY INSTALLATION ON CABIN DOORS	X	I				TB	OPTIONAL INSTL. Operator's initiative.				
		52-09		*		83-169-035		NEW LOWER BALL JOINT BLOCK ON SLIDING DOOR	X	I		1		ASB	INCORPORATED IN MSM-ASL	INCORP. IN PUBLICATION REF MSM REV 6 2017-04-10	HNAB CAMO	2017-08-21	SE-MG.0092, ARS-3 LGD
		52-10	1				1279	SLIDING DOOR CLOSING SYSTEM CONTROL RODS	X	I				TB		NA, NOT INSTALLED	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B

REG	MODEL	A-TCDS	TCDS	SN	YEAR	MANDATORY SERVICE BULLETINES & ADS										MRF	JVK-2018-04	SIGN:		CAMO	HNAB, SE.MG.0092			
SE-JVK	AS350BA	R.008	6	1922	1986	AIRFRAME "ASB" ADS										PAGE	of	Update EASA:	BW 2019-04	CAT = ASB-SB-TB			Date:	22-11 2018
Date	ATA	SB	Rev	EASA	FAA-AD	FR-AD	MOD	ACTION				BA	PART	REP	F.DUE	D. DATE	CAT	REMARK	ACTION TAKEN		W.O.	DATE	MECH	
04-10		52-14	4				0046-0604-0565-1845	SLIDING DOORS	X	I						TB	OPTIONAL FOR FLYING WITH DOORS OPEN	NA, NOT INSTALLED		MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01		
		52-18	*			87-088-049	1845-1847	NEW BALL JOINT PIN ON SLIDING DOOR, RH-LH SIDE	X	I			1			ASB		NA, NOT INSTALLED		10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B		
		52-21	2				1986-2204-2460	IMPROVEMENT OF UPPER STRIKING PLATE LOCKING ON BASIC DOORS	X	I						TB	OPTIONAL INSTL. Operator's initiative.							
		52-22					1415	LOCKING PILOT- COPILOT SMALL CABIN DOORS	X	I						TB	OPTIONAL INSTL. Operator's initiative.							
		52-23	1				2441	VIB. DAMPER BLADE PN 350A21-1383-23	X	I						TB	OPTIONAL INSTL. Operator's initiative.							
		52-24						IMPROVED PILOT DOOR AND COPILOT DOOR DEFLECTOR ATTACHMENT	X	I						TB	OPTIONAL INSTL. Operator's initiative.							
		52-25					3016	IMPROVED CLOSING SYSTEM FOR THE SIDE BAGGAGE COMPARTMENT DOORS	X	I						TB	OPTIONAL INSTL. Operator's initiative.							
		52-26	1					ADDING ANOTHER LOCK TO THE BAGGAGE COMPARTMENT BASIC VERSION	X	I						TB	OPTIONAL INSTL. Operator's initiative.							
		52-29	1	06-0249			3287-3290	SLIDING DOORS	X	I						ASB	SS BY THE ASB 05-41	NA, NOT INSTALLED		MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01		
		52-30	1	07-0236			3298-3308	SLIDING DOORS - MODIFICATION TO SLIDING DOOR MEDIUM ROLLER PIN AND FITTING	X	I						ASB	SS EASA AD 2006-0251R2	NA, NOT INSTALLED		10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B		
16-04	52	52-32	2				AL4220	DOORS - Improvement of window panel installation on pilot and copilot doors	X	I						SB	OPTIONAL INSTL. Operator's initiative.							
12-10		52-34	1	12-0205	2013-23-09			SLIDING DOORS - LOWER BALL JOINT - MODIFICATION	X	I			1			ASB		NA, NOT INSTALLED		10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B		
12-10		52-35						CHECK OF THE INSTALLATION OF THE CREW DOOR ACTUATORS	X	I						SB								
12-10		53-06	3				0475-0477-1364	BALLAST CAPABILITY IN TAILBOOM - INCREASE CABIN LOADING CAPACITY	X	I						SB	OPTIONAL INSTL. Operator's initiative.							
		53-16	4				1323-1447-2216	LOCKING THE MGB AND ENGINE COWLINGS	X	I						TB		C.W.						
		53-18					1703	TAIL BOOM CAPABLE OF REINFORCED HORIZONTAL STABILIZER	X	I						TB	OPTIONAL INSTL BA MOD	C.W AT BA MOD		10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B		
		53-22	3				1927	TWO PIECE WINDSHIELD INSTALLATION	X	I						TB	OPTIONAL INSTL. Operator's initiative.							
		53-23	1						X	I						TB	OPTIONAL INSTL. Operator's initiative.							
02-06		53-24	2				AOP2364	ELIMINATION OF THE ENTABLATURE ON THE LEFT SIDE OF THE INSTRUMENT PANEL	X	I						TB	OPTIONAL INSTL. Operator's initiative.							
14-11	53	53-28	2				OP0478-4327	FUSELAGE - TAIL ROTOR PROTECTION	X	I						SB	OPTIONAL INSTL. Operator's initiative.							
02-07		53-31	*	2003-15-08	02-537-094	3161		REPLACEMENT OF MGB OPENING COWLING SEALS	X	I			1			ASB		P.C.W		10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B		
07-05		53-37		07-0139-E	2013-23-10		0484	FUSELAGE - CHECK OF THE CONFORMITY OF THE CENTER CROSS MEMBER AT X 2325 UNDER THE CABIN FLOOR	X	I			1			ASB	HCP WITH COLLECTIVE TO YAW CTR COUPLING	C.W INSP		164/11	19-6-2011	Thierry D. Bigara A&P 2541811A		
14-12	53	53-40							X	I						SB								

REG	MODEL	A-TCDS	TCDS	SN	YEAR	MANDATORY SERVICE BULLETINES & ADS							MRF	JVK-2018-04	SIGN:	CAMO	HNAB, SE.MG.0092		
SE-JVK	AS350BA	R.008	6	1922	1986	AIRFRAME "ASB" ADS					PAGE	of	Update EASA:	BW 2019-04	CAT = ASB-SB-TB		Date:	22-11 2018	
Date	ATA	SB	Rev	EASA	FAA-AD	FR-AD	MOD	ACTION	BA	PART	REP	F.DUE	D. DATE	CAT	REMARK	ACTION TAKEN	W.O.	DATE	MECH
14-12	53	53-48						REINFORCEMENT OF THE LOWER CROSSBEAM OF THE YAW CONTROL BELLCRANK SUPPORT	X	I				SB					
		55-02	1 *			81-223-022 81-203-021	1046-1050	IMPROVED ASSEMBLY OF UPPER & LOWER FINNS, PN 350A14-0020, -0021	X	I		1		ASB	10 hrs insp Until Mod C.W	C.W AT PRODUCTION	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
85-08		55-03	2 *		2011-18-12	82-98-26	1047	UPPER TAIL FIN PN 350A14-0020	X	I		1		ASB	SB 05.46 FAA AD 82-13-05R1 SS	P.C.W MOD IAW SB 55.16 R1	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		55-05	1				1393	REINFORCEMENT OF THE UPPER FIN	X	I				TB	OPTIONAL INSTL. Operator's initiative.				
		55-07					2367	REINFORCEMENT OF UPPER TAIL FIN LIGHT	X	I				TB	OPTIONAL INSTL. Operator's initiative.				
03-02		55-09						STABILIZERS CHECK OF FIN ATTACHMENT FRAME	X	I				SB	P.CW PARA 2.B.1	C.W PARA 2.B.2, AC1112,7 HRS NEXT DUE 1712,7 HRS (INCORP MET INSP)	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
03-02		55-11					3382	IMPROVEMENT OF FIN ATTACHMENT	X	I		1		SB	AIRBUS REC	HELIAIR MM HELD 170413 DECIDED NOT INCORP THIS MOD		2018-03-01	SE-MG.0092, ARS-3 LGD
07-01		55-12	2				3288	STABILIZERS IMPROVEMENT OF UPPER AND LOWER VERTICAL STABILIZER ATTACHMENT	X	I		1		ASB	SB & AD SS BY SB 55.16 & AD 08-0121	P.C.W.	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
09-02		55-16		09-0030	2011-18-12		3330	STABILIZERS IMPROVEMENT OF UPPER AND LOWER VERTICAL STABILIZER ATTACHMENT	X	I		1		ASB	PN 350A14-ALL	P.C.W NEW TYPE INSTALLED	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
13-04	55	55-17	1				3331	STABILIZERS - Upper fin; Checking tool for the upper fin	X	I				SB	AIRBUS REC. TO OPERATOR	C.W			
15-06	55	55-18					4643	STABILIZER - Horizontal stabilizer, Improvement of the Stabilizer / Tail Boom Fittings interface	X	I				SB	AIRBUS REC. TO OPERATOR	C.W			
16-06	55	55-19					4613	FUSELAGE - Improvement of assembly of vertical stabilizer tip attachment angles	X	I				SB	AIRBUS REC. TO OPERATOR	C.W			
15-01	56	56-05	1					WINDOWS - WINDSHIELD SEALING IMPROVEMENT BETWEEN CANOPY AND 7" BULKHEAD	X	I				TB	OPTIONAL INSTL. Operator's initiative.				
03-04		62-01	1				6113	MRH REINFORCEMENT OF THE SWIVEL BRG GUIDE	X	I				TB	OPTIONAL INSTL. Operator's initiative.				
02-05		62-02	2		2004-05-23		6124	NON ROTATING SWASHPLATE	X	I		1		ASB	SS FAA AD 89-29-01, 100 HRS GREASING	P.C.W MOD, INSP INCORP IN MSM	10-1071	17-5-2010	HELITENDER INC CRS 1HTR181B
		62-08						PLANET GEAR CAGE TO ROTOR SHAFT ATTACHMENT BOLTS	X	I		1		ASB	REF SB 65-26	NA DUE TO PN INSTALLED	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		62-11					1982	IMPROVED CHIP DETECTOR ELECTRICAL BONDING	X	I				TB	OPTIONAL INSTL. Operator's initiative.				
02-05		62-12	2 *		2004-05-23	89-155-054r4	6124	CHECKING ROTATING STARS FITTED WITH BEARINGS PNs 704A33-651-051, -080, -126	X	I		1		ASB	100 HRS GREASING	P.C.W MOD, INSP INCORP IN MSM & MP-AS350	HNAB CAMO	2017-08-21	SE-MG.0092, ARS-3 LGD
16-09	62	62-14	2				6160-6161- 6194-6200	INSTL OF SLEEVE ATTACHMENT BEAMS WITH STRAIGHT WINDINGS	X	I				SB	OPTIONAL INSTL. Operator's initiative.				
		62-15	1				6169	HEAT SHRINKABLE SHEATH ELIMINATED ON YELLOW PITCH CHANGE ROD	X	I				TB	OPTIONAL INSTL	P.C.W	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		62-16					6166	BONDING BRAVE WITH SLEEVE MADE OF WITON COMPOUND, NEW ATTACH TABS	X	I				TB	OPTIONAL INSTL. Operator's initiative.				
		62-17	1				6187-6188	OPERATING LIMITAT SWASHPLATE BEARINGS, PNs 704A33-651-051, -080, -126	X	I				TB	OPTIONAL INSTL. Operator's initiative.				
		62-18	2					ROTOR MAST ASSEMBLY FITTED WITH A 4 CONTACT, PN 350A37-0004-02	X	I				TB	OPTIONAL INSTL. Operator's initiative.				

REG	MODEL	A-TCDS	TCDS	SN	YEAR	MANDATORY SERVICE BULLETINES & ADS							MRF	JVK-2018-04	SIGN:	CAMO	HNAB, SE.MG.0092				
SE-JVK	AS350BA	R.008	6	1922	1986	AIRFRAME "ASB" ADS					PAGE	of	Update EASA:	BW 2019-04	CAT = ASB-SB-TB		Date:	22-11 2018			
Date	ATA	SB	Rev	EASA	FAA-AD	FR-AD	MOD	ACTION			BA	PART	REP	F.DUE	D. DATE	CAT	REMARK	ACTION TAKEN	W.O.	DATE	MECH
		62-21	1	*		92-179-064r1		M/R PITCH CHANGE LEVER BUSHES			X	I		1		ASB		P.C.W	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		62-22					A08-0720	M/R SPRING TYPE DAMPER VIB DAMPER			X	I		1		ASB	BA CONVERSION	C.W MOD INCORP	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
02-05		62-24		*		01-557-086r3	6221	INSTALLING A STUD TO STOP THE BUSH AT THE END OF THE STARFLEX STAR ARM.			X	I		1		ASB	POST MOD 6209	NA BY PN	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
03-05		62-25		*	2003-14-12	02-452R1		MAIN ROTOR - TAIL ROTOR; CORRECTING OF OPERATING HOURS			X	I		1		ASB	SB REF NOTED ON COMP CARDS	NA DUE TO SN & PN INSTALLED	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
09-02		62-31					6232	MAIN ROTOR - FREQUENCY DAMPER VENTILATION			X	I				SB	OPTIONAL INSTL. Operator's initiative.				
14-04	62	62-34		14-0132R1	2015-17-11			MAIN ROTOR - SWASHPLATES, (MP/N) 350A371003-04, -05, -06, -07 or -08.			X	I		1		ASB		C.W. INSP. & MOD PERFORMED	WO: 975	2014-10-07	KALLAXFLYG SE.145.0030
17-02	62	62-38		17-0032				Check of the main rotor hub / mast attachment screws			X	I		1		ASB	Which operate in a salt-laden or tropical and damp atmosphere	C.W. INSP IN CORROSIVE OPERATION			
17-05	63	62-39	1	17-0089	2018-02-02			MAIN ROTOR- ROTOR MAST, CHECK OF THE ROTOR MAST OIL PIPE			X	I		1		ASB		C.W IAW PARA 3.B.1, 3.B.2, 3.B.6 AND 3.B.3 NO OBSTRUCTION	HA-JVK-17-001	26-5-2017	HELIAIR, JA, SE.145.0131
18-09	62	62-42		2018-0026				MAIN ROTOR MAST- -Mast Upper Bearing Sealant Bead / Inner Race Retaining Rings – Inspection			X	I	1	1	01-09-20	ASB	CW EVERY 165 HRS UNTIL CW PARA 3.B.2.b	C.W. CHECK PARA 3.B.2.a, INSPECTION	SE-JVK-18-004		
10-01		63-02				9539		BOLTS OF THE ENGINE TO MGB FLEXIBLE COUPLING ENTIRELY CADMIUM PLATED			X	I				TB	OPTIONAL INSTL. Operator's initiative.				
		63-03	2			7092-7111-7114		PUTTING INTO SERV.THE REINFORCED EPICYC. RED. GEAR. PN350A32-0100-10 & -0110-00			X	I				TB	OPTIONAL INSTL. Operator's initiative.				
10-01		63-04				9533		FIREPROOF PANEL PROTECTING ENGINE TO MGB COUPLING SHAFT			X	I				TB	OPTIONAL INSTL. Operator's initiative.				
		63-06						MGB LUBRICATION SYSTEM LINES CHECK			X	I				TB	OPTIONAL INSTL	P.C.W NEW TYPE INSTALLED	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		63-07				2720		NEW MGB BASE BIDIRECTIONAL CROSSBEAM			X	I				TB	INSTAL PN 350A38-1040-20	P.C.W NEW TYPE INSTALLED	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
10-01		63-08			2007-06-15	9555-9558-9559-9563		INSTALLATION A POLY-V TYPE DRIVE BELT ON DRIVING HYDRAULIC PUMP			X	I				TB	OPTIONAL, OLD BELTS NOT FOR SALE	C.W MOD	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
05-05		63-09	1			7175		INSTL. OF LONG ELECTRIC MAGNETIC PLUG IN MGB			X	I				TB	MGB PUMP-RGB EXT TO 3500HRS	P.C.W AT MGB REDUCTION EXCH.	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
03-01		63-11						CHECKING THE BUSHES OF THE ENGINE/MGB COUPLING GIMBAL RING			X	I		1		ASB		NA DUE TO DATE AND BATCH NO	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
03-01		63-12				7162		NEW MGB OIL FILTER CARTRIDGE			X	I				TB	OPTIONAL INSTL. Operator's initiative.				
04-05		63-14				9563		POLY V BELT INST - NEW BELT TENSION VALUE			X	I				TB		P.C.W	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
04-05		63-16						CHECK OF HYDRAULIC PUMP PULLEY			X	I				TB		P.C.W	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
16-07	63	63-17	3					CHECK OF HYDRAULIC PUMP DRIVE PULLEY			X	I				SB	OPTIONAL INSTL. Operator's initiative.				
16-07	63	63-18	4			4223		MAIN ROTOR DRIVE - Main Rotor Hub (MRH), Installation of a new NR sensor on the Main Rotor Hub (MRH)			X	I				SB	OPTIONAL INSTL. Operator's initiative.				
16-07	63	63-20						MAIN ROTOR DRIVE - MRG LUBRICATION SYSTEM, REPLACEMENT OF SEVERAL HOSES			X	I				SB	OPTIONAL INSTL. Operator's initiative.				
15-07	63	63-23				7240		MAIN ROTOR DRIVE - Modification of material and position of MGB intake O-ring			X	I				SB	OPTIONAL INSTL. Operator's initiative.				

REG	MODEL	A-TCDS	TCDS	SN	YEAR	MANDATORY SERVICE BULLETINES & ADS							MRF	JVK-2018-04	SIGN:	CAMO	HNAB, SE.MG.0092					
SE-JVK	AS350BA	R.008	6	1922	1986	AIRFRAME "ASB" ADS							PAGE	of	Update EASA:	BW 2019-04	CAT = ASB-SB-TB		Date:	22-11 2018		
Date	ATA	SB	Rev	EASA	FAA-AD	FR-AD	MOD	ACTION				BA	PART	REP	F.DUE	D. DATE	CAT	REMARK	ACTION TAKEN	W.O.	DATE	MECH
14-10	63	63-24			2017-22-05		9568	MAIN ROTOR DRIVE - Engine-to-MGB coupling, New hydraulic pump drive bearing, PUMP (P/N) 350A35-0132-00.				X	I		1		ASB	INCORPORATED IN MSM-ASL	INCORP. IN PUBLICATION REF MSM REV 6 2017-04-10	HNAB CAMO	2017-08-21	SE-MG.0092, ARS-3 LGD
15-04	63	63-25	1				4713	MAIN ROTOR DRIVE - NR sensor, Modification of the NR sensor electrical system				X	I				SB	AIRBUS REC. TO OPERATOR				
16-06	63	63-26					9804	MAIN ROTOR DRIVE - MGB / Engine Coupling - Increase of tightening torque of the MGB/engine coupling				X	I				SB	AIRBUS REC. TO OPERATOR				
		64-03	1				5588	IMPROVED PRE-LOADING OF LAMINATED HALF BEARINGS				X	I				TB	OPTIONAL INSTL. Operator's initiative.				
07-02		64-05	2	*	2014-04-11	04-178		TAIL ROTOR - TAIL ROTOR BLADE TRAILING EDGE TAB				X	I		1		ASB	PN 355A12-0040-ALL	NA BY PN INSTALLED	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
16-05	64	64-09	1				6602-8551	TAIL ROTOR - Anti-torque rotor, Installation of new pitch rods and TGB control lever				X	I				SB	AIRBUS REC. TO OPERATOR				
16-05	64	64-11			2014-05-10			TAIL ROTOR - TAIL ROTOR BLADES				X	I				SB	AIRBUS REC. TO OPERATOR				
		65-01		*	80-15-13	78-204-002		CHECKING THE ROTATING STAR DRIVE IN THE MAIN ROTOR SHAFT ASSEMBLY PN 350A37-0003-				X	I		1		ASB		P.C.W AT PRODUCTION	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		65-02					5512-5516-5519-5521-5524	T/R WIDER SHOULDER ON BLADE HORN BUSHES				X	I				TB	OPTIONAL INSTL. Operator's initiative.				
		65-03					6507-6510-6512-6513-8515	T/R IMPROVED BLADE HORN/FIXED BALL JOINT SWAGING				X	I				TB	OPTIONAL INSTL. Operator's initiative.				
		65-05						REST BLOCKS ON MAIN ROTOR				X	I				TB	OPTIONAL INSTL. Operator's initiative.				
		65-07		*		79-012-004	8517	ATTACHMENT SCREWS ON TAIL GEAR BOX ATTACHING LUG				X	I		1		ASB		P.C.W AT PRODUCTION	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		65-08	2	*		79-174-009	8519	T.G.B INCREASED PRE-STRESS ON TAPER ROLLER BRG				X	I		1		ASB		NA BY DASH NO OF EARBOX		26-10-2016	HELIAIR SE.MG.0064
03-04		65-10					0441-0621-0794-0868	N.ROTOR IND WITH NEW IND AND SENSOR				X	I				TB	OPTIONAL INSTL. Operator's initiative.				
03-04		65-11					8520	TGB CASING LUG				X	I				TB	OPTIONAL INSTL. Operator's initiative.				
03-04		65-12	1				6544	TAIL ROTOR HUB PITCH CHANGE SPIDER				X	I				TB	OPTIONAL INSTL. Operator's initiative.				
		65-13		*	80-22-08	79-217-011	6519	WEAR TELL-TALEWASHER FOR LAMINATED BEARING ON TAIL ROTOR HUB				X	I		1		ASB		P.C.W AT PRODUCTION	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
03-04		65-14						CHECKING TORQUE LOADING OF BOLTS ATTACHING EPICYCLIC RED GEAR				X	I		1		ASB		P.C.W AT EUROCOPTER	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
03-04		65-16					6061					X	I				TB	OPTIONAL INSTL. Operator's initiative.				
03-04		65-17					5019	MAIN ROTOR BLADES - USING SCOTCH TAPE Y 9265 SA				X	I				TB	OPTIONAL INSTL. Operator's initiative.				
		65-18		*		80-104-013	0733	MGB OIL TEMP PROBE WITH IMPROVED GROUNDING				X	I		1		ASB		P.C.W AT PRODUCTION	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
03-04		65-19	1				8525	TAIL ROTOR IMMOBILISATION PIN				X	I		1		ASB		P.C.W INCORP. MSM	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
03-04		65-20		*		82-175-29B	0720-1211	MGB- TGB INSTL CHIP ELECTRICAL DETECTORS				X	I		1		ASB		P.C.W AT EUROCOPTER	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
03-04		65-21	1				6522-5532-6527	TAIL ROTOR HUB				X	I		1		ASB		P.C.W INCORP. MSM	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
03-04		65-22					6069-7034-6142	MR MAST - INSTALLATION OF QUICKLY REM MAG CHIP PLUG				X	I				TB	OPTIONAL INSTL. Operator's initiative.				

REG	MODEL	A-TCDS	TCDS	SN	YEAR	MANDATORY SERVICE BULLETINES & ADS						MRF	JVK-2018-04	SIGN:	CAMO	HNAB, SE.MG.0092			
SE-JVK	AS350BA	R.008	6	1922	1986	AIRFRAME "ASB" ADS						PAGE	of	Update EASA:	BW 2019-04	CAT = ASB-SB-TB	Date:	22-11 2018	
Date	ATA	SB	Rev	EASA	FAA-AD	FR-AD	MOD	ACTION	BA	PART	REP	F.DUE	D. DATE	CAT	REMARK	ACTION TAKEN	W.O.	DATE	MECH
03-04		65-23					6078-6072		X	I				TB	OPTIONAL INSTL. Operator's initiative.				
03-04		65-24	2				6053-6085	THREE PLY FREQUENCY ADAPTORS ON MRH	X	I				TB	OPTIONAL INSTL. Operator's initiative.				
03-04		65-25					9512-9526	HYDRAULIC PUMP DRIVE	X	I				TB	OPTIONAL INSTL. Operator's initiative.				
		65-26	1				6087	LOCKWASHER FOR MAST / PLANET GEAR CARRIER ATTACHMENT BOLT. SHAFT PN 350A37-0003-ALL	X	I		1		ASB		P.C.W AT PRODUCTION	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		65-27					6078	REPLACEMENT OF STARFLEX HUB ATTACHMENT BOLTS	X	I				TB	OPTIONAL INSTL. Operator's initiative.				
		65-28	3				5532-6523	T/R ADDITION OF A WEAR INDICATING WASHER	X	I				TB	OPTIONAL INSTL. Operator's initiative.				
03-04		65-29					6089-6098-6114	MAIN ROTOR - NEW STAR PN	X	I				TB	OPTIONAL INSTL. Operator's initiative.				
03-04		65-30					8527	TGB - PITCH CHANGE CONTROL BELLCRANK EQUIPPED WITH CARBIDE BUSHES	X	I				TB	OPTIONAL INSTL. Operator's initiative.				
03-04		65-32					9025	TAIL ROTOR DRIVE SYSTEM, NEW ELASTOMER SLEEVES	X	I				TB	OPTIONAL INSTL. Operator's initiative.				
03-04		65-33	1				6536	TGB SPIDER, SPIDER CONTROL CHECK	X	I				TB	SUPERSEDED BY SB 05-33	NA BY PN INSTALLED	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		65-34						TGB FRONT ATTACHMENT BOLTS	X	I				TB	OPTIONAL INSTL. Operator's initiative.				
		65-35	1				6544	TAIL ROTOR DRIVE, T/R HUB PITCH CHANGE SPIDER	X	I				TB	C.W SB 05-33	C.W SB 65-38r1			
		65-36					8543	TGB INPUT FLANGE SPLINES AND TIGHTENING TORQUE CHECK	X	I				TB	OPTIONAL INSTL. Operator's initiative.				
		65-37						T/R DRIVE ;DRIVE SHAFT FLANGE CHECK, ON TGB END	X	I				TB	OPTIONAL INSTL. Operator's initiative.				
01-02		65-38	1 *			99-085-076r3	6551, 6544	CHECK T/R PITCH CHANGE BEARING MOD, UPGRADE SPIDER PN TO 350A33-2005-06	X	I		1		ASB	BRG 6010F234M16 INSTALLED	NA BY PN INSTALLED	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		65-39						CHECK OF TR DRIVE SHAFT BEARINGS	X	I				TB	OPTIONAL INSTL. Operator's initiative.				
02-11		65-42					8525-8527-8533	TRD - CHECKING THE INSTALLATION OF THE PITCH CHANGE CONTROL BELLCRANK	X	I				SB	OPTIONAL INSTL. Operator's initiative.				
03-04	65	65-43	1				6550	TAIL ROTOR PITCH CHANGE PLATE - FOUR-CONTACT BEARING	X	I				TB	REF SB 01-48 & 5-29	P.C.W MOD NEXT BRG LIFE 3000 HRS, (INCRP MET INSP)	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
09-02		65-45						TGB - ATTACHMENT NUTS SECURING THE TGB ON THE FRONT MOUNT	X	I		1		ASB		C.W CHECK PARA 2	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
11-05		65-46		11-0104	2013-16-03			TAIL ROTOR DRIVE -TGB CASING ASSEMBLY - INSPECTION/REPLACEMENT	X	I		1		ASB	CASING ASSY 350A33-1090-02	NA DUE TO CASING SN INSTALLED IS NOT LISTED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
		67-01		*		70-013-005	0452	FLYING CONTROLS REINFORCED YAW CONTROL ROD	X	I		1		ASB		P.C.W AT PRODUCTION	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		67-09						FRICITION ON PILOTS CYCLIC STICK	X	I				TB	OPTIONAL	NA	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
		67-11	1		90-23-03		2207-0923	DUNLOP SERVO CONTROLS INSP SCREWS	X	I		1		ASB	REF 01-21R1	P.C.W INCRP. IN MSM	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
03-04		67-12					1834	NEW PILOTS COLLECTIVE LEVER GRIP	X	I				TB	OPTIONAL INSTL. Operator's initiative.				
		67-13	1				1941	REMOVABILITY OF YAW CONTROL ROD BEARING NO 1	X	I				TB	OPTIONAL INSTL. Operator's initiative.				
03-04		67-15					1704-1705	CORRECT POSITION OF THE COPILOT'S CYCLIC STICK	X	I		1		ASB		P.C.W INCRP. IN MSM	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B

REG	MODEL	A-TCDS	TCDS	SN	YEAR	MANDATORY SERVICE BULLETINES & ADS							MRF	JVK-2018-04	SIGN:	CAMO	HNAB, SE.MG.0092				
SE-JVK	AS350BA	R.008	6	1922	1986	AIRFRAME "ASB" ADS					PAGE	of	Update EASA:	BW 2019-04	CAT = ASB-SB-TB		Date:	22-11 2018			
Date	ATA	SB	Rev	EASA	FAA-AD	FR-AD	MOD	ACTION			BA	PART	REP	F.DUE	D. DATE	CAT	REMARK	ACTION TAKEN	W.O.	DATE	MECH
07-10		67-16	1				1995	BLANKING OF UPR CAVITY IN COLLECT PITCH LEVER STOP			X	I		1		ASB		C.W MOD INCORP AT BA CONVERSION	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
		67-17	2				2299-2228-2254	SWITCH GUARD OF THE HYD CUTOFF AND EMERGENCY RELEASE SWITCHES ON THE PILOT'S AND COP COLLECTIVE PITCH LEVER			X	I				TB	OPTIONAL INSTL. Operator's initiative.				
06-06		67-21	1				3175	ROTOR - FLIGHTS CONTROL, COLLECTIVE LEVER HOOKING WITH RETURN SPRING			X	I				TB	OPTIONAL INSTL. Operator's initiative.				
02-09		67-22	1				3139	DUBLE LOCKING OF TAIL SERVO CONTROL END FITTING			X	I		1		ASB	REF SB 05-37	P.C.W MOD (INCORP MET INSP)	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
04-05		67-24	*			03-002R1	3179	MRC - CYCLIC STICK IN THE NOSE UP CONTROL POSITION - CHECK FOR LOWER FRICTION CUP OVERLAPPING			X	I		1		ASB	POST MOD 0682 PRE MOD 3179	P.C.W	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
04-03		67-25	1	*		03-322r1	3206-3102	ROTOR FLIGHT CONTROL: INTRO. OF DOUBLE LOCKING OF FLIGHT CTR STOP SCREWS BE SEALING THE SCREWS			X	I		1		ASB	C.W. 2.B.2 WITHIN 500 HRS/1 YR	P.C.W	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
05-04		67-26	1	*		05-042	2771	ROTOR FLIGHT CONTROL: YAW CONTROL, REPLACING STEEL-CAGEED BALL TYPE CTR WITH (PTFE)			X	I		1		ASB		P.C.W MOD	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
03-10		67-27	1	*		03-406	2771	ROTOR FLIGHT CONTROL: CHECK COLLECTIVE LEVER LOCK FOR WEAR			X	I		1		ASB		C.W PARA 2.B.2 , NA DUE TO OLD TYPE LEVER INSTALLED	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
08-02		67-32	1				3304	ROTOR FLIGHTS CONTROL - INSTL OF "HYD TEST" PUSH BUTTON FLAP ON HONEYWELL CTR. UNIT			X	I				SB	OPTIONAL INSTL. Operator's initiative.				
13-12	67	67-37	3	09-0019	2014-02-05		3237	ROTOR FLIGHT CONTROLS - NEW COLLECTIVE STICK HOOKING LOCK			X	I		1		ASB	OPTIONAL INSTL	NA DUE TO INSTALLATION OLD TYPE	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
12-08		67-41					3221	INSTALLATION OF GOODRICH NEW GENERATION MAIN SERVO CONTROLS			X	I				SB	OPTIONAL INSTL. Operator's initiative.				
12-08		67-42	2				3417	REPLACEMENT OF SERVO CONTROLS NUT RETAINER			X	I				SB	OPTIONAL INSTL. Operator's initiative.				
10-02		67-45						MAIN SERVO - ACTUATOR INPUT LEVER ATTACHMENT			X	I				SB		C.W INSP. IAW PARA 1.E.2.a	MAC 13-052	25-6-2013	MAC SE.145.0113 NE AT-17
15-11	67	67-50	1					OPTIMIZING TOF THE YAW SHEAT ROUTING			X	I				SB		SS BY 67.00.57	HNAB CAMO	2017-08-21	SE-MG.0092, ARS-3 LGD
15-11	67	67-52	1				3417	REPLACEMENT OF SERVO CONTROLS NUT RETAINER			X	I				SB	OPTIONAL INSTL. Operator's initiative.				
15-11	67	67-56					4298	NEW COLLECTIVE STICK HOOKING LOCK			X	I				SB	OPTIONAL INSTL. Operator's initiative.				
15-11	67	67-58	1				4331	ROTOR FLIGHT CONTROLS - Yaw Control, Addition of a lock-washer between the sheath stop nuts and lock-nuts of the yaw ball-type control			X	I	1	1		SB	AIRBUS RECOMENDATION	C.W	SE-JVK-18-004		
13-04	A	67-60	0	13-0095-E	2013-10-51			HYDRAULIC MAIN & T/R SERVO CONTROL BEARINGS , CHECK FOR EXCESSIVE PLAY			X	I		1		ASB		C.W INSP. IAW PARA 1.E.2, NA DUE TO MOD STATUS	MAC 13-052	25-6-2013	MAC SE.145.0113 NE AT-17
17-01	67	67-61	2				4602-1908-1912	Installation of dual mechanical safetying on primary yaw stops			X	I		1		ASB	POST MOD 07-2295 helicopters	SB IS CANCELLED	HNAB CAMO	2017-08-21	SE-MG.0092, ARS-3 LGD
	71	71-07	3				1378-OP1670-OP1142	ENGINE WASHING INSTALLATION			X	I				TB	OPTIONAL INSTL. Operator's initiative.				
	71	71-11	2				OP2561-2681	PROTECTION OF AIR INLET			X	I				TB	OPTIONAL INSTL. Operator's initiative.				
15-07	71	71-18	2				3443	POWER PLANT - FIREWALL REINFORCEMENT			X	I				SB	OPTIONAL INSTL. Operator's initiative.				
15-07	71	71-20						CHECK OF THE BETWEEN THE AIR INTAKE SEAL AND THE ENGINE COWLINGPLAY			X	I				SB	OPTIONAL INSTL. Operator's initiative.				
15-07	71	71-24					4277	POWER PLANT - AIR INLET. IMPROVEMENT OF THE LOCKING OF THE AIR INLET SCREEN			X	I				SB	OPTIONAL INSTL. Operator's initiative.				

REG	MODEL	A-TCDS	TCDS	SN	YEAR	MANDATORY SERVICE BULLETINES & ADS										MRF	JVK-2018-04	SIGN:	CAMO	HNAB, SE.MG.0092			
SE-JVK	AS350BA	R.008	6	1922	1986	AIRFRAME "ASB" ADS										PAGE	of	Update EASA:	BW 2019-04	CAT = ASB-SB-TB		Date:	22-11 2018
Date	ATA	SB	Rev	EASA	FAA-AD	FR-AD	MOD	ACTION				BA	PART	REP	F.DUE	D. DATE	CAT	REMARK	ACTION TAKEN	W.O.	DATE	MECH	
14-01	71	71-36					08-1080	POWER PLANT - Air intake, Air intake draining on helicopters equipped with the ARRIEL 1 engine	X	I						ASB	B., BA, B1 ONLY	P.C.W		2018-03-01	SE-MG.0092, ARS-3 LGD		
	76	76-06					2739	FLEXIBLE BALL CONTROL WITH SWIVELLING END FITTINGS	X	I						TB	OPTIONAL INSTL. Operator's initiative.						
	76	76-08						FINGER SUPPLY LOCKING IDLE THROTTLE STOP	X	I						TB	TWIST GRIP	NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01		
	76	76-13					2742	NEW GIMBAL JOINT IN COLLECTIVE PITCH CONTROL LEVER FITTED OUT WITH TWIST GRIP	X	I						TB	TWIST GRIP	NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01		
		77-02	2	*		79-254-012 80-165-014	0804-0615	AMBER ENGINE CHIP LIGHT	X	I			1			ASB		P.C.W AT PRODUCTION	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B		
		77-03	1				0677	BLEED VALVE INDICATOR LIGHT	X	I						TB	OPTIONAL INSTL. Operator's initiative.						
		79-06	2				0549-0815- 0929-1773	INSTALLATION OF AN OIL TANK OF THE 355-365N TYPE	X	I						TB	OPTIONAL INSTL. Operator's initiative.						
		79-09					2397	NEW FAN DUCT	X	I						TB	OPTIONAL INSTL. Operator's initiative.						
		79-10					1616-1814- 2287	REPLACEMENT OF THE 400W FAN BY A 600 OR 800 W FAN	X	I						TB	OPTIONAL INSTL. Operator's initiative.						
		79-11	1	*	2003-08-06	00-268-078	2793	PROTECTION OF PIPE BETWEEN ENGINE AND MGB COMPARTMENT	X	I			1			ASB		P.C.W AT PRODUCTION	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B		
		80-01					2419	DISCHARGE VALVE INDICATION ON THE FAILURE WARNING PANEL	X	I						TB	OPTIONAL INSTL. Operator's initiative.						
		80-04						MODIFICATION OF STARTER GENERATORS, PN 524-030 AND 524-031	X	I						TB	OPTIONAL INSTL. Operator's initiative.						
04-12		80-06						MODIFICATION OF STARTER GENERATORS, PN 524-031	X	I						TB	OPTIONAL INSTL. Operator's initiative.						
09-02		80-07	1	09-0027	2011-10-12			ENGINE STARTING - APC STARTER GENERATORS, PN 150SG122Q, 200SGL130Q	X	I			1			ASB		NA, PN NOT INSTALLED	192/12	2-8-2012	Thierry D. Bigara A&P 2541811A		
		GA107-7			2006-11-17			GENEVA AVIATION INC - CONTROL STICK HANDLE MODIFICATION	X	I			1			ASB	STC # SH4747NM*	NA KIT IS NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01		
15-04	25	SIN-2882-S-25						ZODIAC SB 284-25-004, RISK OF DAMAGE TO THE ZODIAC 284 & 198 SERIES RESTRAINT SYSTEMS	X	I						SIN		NA KIT IS NOT INSTALLED	HNAB CAMO	2017-08-21	SE-MG.0092, ARS-3 LGD		
15-04	25	SIN-2882-S-25						ZODIAC SB 284-25-004, RISK OF DAMAGE TO THE ZODIAC 284 & 198 SERIES RESTRAINT SYSTEMS	X	I						SIN		NA KIT IS NOT INSTALLED	HNAB CAMO	2017-08-21	SE-MG.0092, ARS-3 LGD		
				*		93-067-066	2561, 1536	FLYING UNDER SNOW, CHANGE OF FLIGHT MANUAL	X	I			1			ASB		C.W NEW RFM UPDATED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01		
86-04				*		86-070-045	1671	FUEL FILTER LE BOZEC ET GAUTHIER, DRAIN LEAK CHECK	X	I			1			ASB		P.C.W INCORP. MSM	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01		
				*		94-271		HARNES AND SAFETY PACIFIC SCIENTIFIC	X	I			1			ASB		NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01		
05-04				*		04-174		HYDRUALIC POWER LOSS	X	I			1			ASB	FLM REV	INCORP IN FLM	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01		
01-04				*		01-088-082		REMOVING OF AFT SEAT CUSHIONS AT FLYING WITH OPEN DOORS	X	I			1			ASB	FLYING WITH DOOR OPEN	C.W INCORP REV FLM	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01		
02-06				*		343-25-02		SAFETY BELTS AND RESTRAINT SYSTEMS TYPE 343-1-25-01	X	I			1			ASB		P.C.W	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01		
				*		82-10-01	82-024-024	TAIL ROTOR BLADES INSP, PN 350A12-0020, 12-0030, 08-1011-00, CHECKING BONDING OF STAINLESS EDGE	X	I			1			ASB		N/A DUE TO P/N INSTALLED	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B		
				*		93-050r1		TRANSCIEVER VHF 208 COLLINS	X	I			1			ASB		NA, NOT INSTALLED	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01		

REG	MODEL	A-TCDS	TCDS	SN	YEAR	MANDATORY SERVICE BULLETINES & ADS						MRF	JVK-2018-04	SIGN:	CAMO	HNAB, SE.MG.0092			
SE-JVK	AS350BA	R.008	6	1922	1986	AIRFRAME "ASB" ADS						PAGE	of	Update EASA:	BW 2019-04	CAT = ASB-SB-TB	Date:	22-11 2018	
Date	ATA	SB	Rev	EASA	FAA-AD	FR-AD	MOD	ACTION	BA	PART	REP	F.DUE	D. DATE	CAT	REMARK	ACTION TAKEN	W.O.	DATE	MECH
				07-0289				Rotor flight controls - Collective lever recess - Modification.	X			1		ASB					
10-02				09-0183CN				CANCELLATION NOTICE - EQUIPMENT FURNISHING - D-LOK HOOK OF THE RESCUE HOIST - INSPECTION / REMOVAL FROM SERVICE/REPLACEMENT	X			1		ASB	THIS AD SUPERSEDED 09-0179E	CANCELLED	HA CAMO	26-10-2016	HELIAIR SE.MG.0064
				09-0262R1				FIRE PROTECTION- PORTABLE HALON 1211 FIRE EXTINGUISHERS	X			1		ASB		NA NOT FITTED TO AC	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
10-02				09-0277-R1				FIRE PROTECTION - PORTABLE HALON 1211 FIRE EXTINGUISHERS - IDENTIFICATION / REPLACEMENT	X			1		ASB		NA NOT FITTED TO AC	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
				09-0278				FIRE EXTINGUISHER - PORTABLE HALON 1211	X			1		ASB		NA NOT FITTED TO AC	HA CAMO	26-10-2016	HELIAIR SE.MG.0064
10-05				10-0062-R1				FIRE PROTECTION - PORTABLE HALON 1211 FIRE EXTINGUISHERS - IDENTIFICATION / REPLACEMENT	X			1		ASB	PN: REF FFE ASB 26-116	NA DUE TO PN AND SN INSTALLED IN HELICOPTER	10-1071	15-5-2010	HELITENDER INC CRS 1HTR181B
11-03				11-0033				HYDRAULIC POWER - FWD HYDRAULIC SERCO CONTROL HOSES / PROTECTION INSTALLATION	X			1		ASB		NA NOT FITTED TO AC	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
				11-0094				LIFE JACKET - VACCUM BAG	X			1		ASB		NA NOT FITTED TO AC	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
16-09				11-0103				EQUIPMENT - ELT ANTENNA - MODIFICATION/ REPLACEMENT - COBHAM AVIONCS	X			1		ASB	CHELTON TRI-BAND, PN: 21-41, COBHAM SB 042015-001 Issue 2	NA DUE TO TYPE INSTALLED	HA CAMO	26-10 2016	HELIAIR SE.MG.0064
				11-0239				NAVIGATION - RADIO ALTIMETER INDICATOR - MODIFICATION	X			1		ASB		NA NOT FITTED TO AC	MAC CAMO	30-6-2013	SE-MG.0095 MAC-ARS-06
				13-0020				SAFETY HARNESS - INSPECTION / REPLACEMENT	X			1		ASB		NA DUE TO TYPE INSTALLED	HA CAMO	26-10-2016	HELIAIR SE.MG.0064
				13-0020R4				SAFTYBELTS INSPECTION	X			1		ASB		NA NOT FITTED TO AC	MAC CAMO	1-7-2013	SE-MG.0095 MAC-ARS-07
				14-0279				RESTRAINT SYSTEM ROTARY BUCKLE SUB ASSY ANJOU AERON. SB 358 SB -14-101R1	X			1		ASB		NA DUE TO TYPE INSTALLED	HA CAMO	26-10-2016	HELIAIR SE.MG.0064
15-07	5			15-0132				TIME LIMITS/MAINTENANCE CHECKS - AIRWORTHINESS LIMITATION - REVISION IMPLEMENTATION	X			1		ASB	ALS REV. INCORP IN MP-AS350BA	NA DUE TO TYPE INSTALLED	HA CAMO	26-10-2016	HELIAIR SE.MG.0064
	24			17-0143				Electrical Power - Direct Current (Optional) Second Battery	X			1		ASB		NA DUE TO TYPE OF BATTERY INSTALLED	HA CAMO	26-10-2016	HELIAIR SE.MG.0064
				CF-14-26				Standard Practices - Helicopter External Transport System	X			1		ASB		NA, NOT INSTALLED	HNAB CAMO	2017-08-21	SE-MG.0092, ARS-3 LGD
				FAA AD 83-11-01R1				AIR CRUISER FLOTATION GEAR KIT INSTALLED I.A.W STC SH4032SW	X			1		ASB		NA NOT FITTED TO AC	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
				FAA AD 98-25-10				AIRCRAFT BELTS	X			1		ASB		NA NOT FITTED TO AC	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
				FAA AD 86-05-02				ALTIMETER CHECK	X			1		ASB		NA NOT FITTED TO AC	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
				FAA AD 81-15-02				EMERGENCY FLOTATION GEAR MODEL D24374, INSTALLED I.A.W STC SH2825SW	X			1		ASB		NA NOT FITTED TO AC	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
				FAA AD 2011-11-04				HALON FIRE EXTINGUISHER -CONTAMINATED LIQUED CHECK PN INSTALLED	X			1		ASB		NA DUE TO NEW FIRE EXTINGUISHER INSTALLED	192/12	2-8-2012	Thierry D. Bigara A&P 2541811IA
				FAA AD 87-06-09				MECHANICAL PRODUCTS CIRCUIT BREAKERS	X			1		ASB		NA NOT FITTED TO AC	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
				FAA AD 89-06-01				SWITLIK LIFE PRESERVERS	X			1		ASB		NA NOT FITTED TO AC	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
				FAA AD 98-24-35				TAIL ROTOR ASSY PITCH LINKS PN 350A33-2145-01, INSP SWAGING	X			1		ASB		NA NOT FITTED TO AC	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01
				FAA AD 98-14-03				TRANSPONDER CHECK KING KT 76A, PN 066-1062/-00/-10/-02	X			1		ASB		NA NOT FITTED TO AC	MAC CAMO	25-6-2013	SE-MG.0095 MAC-ARS-01

REG	MODEL	A-TCDS	TCDS	SN	YEAR	MANDATORY SERVICE BULLETINES & ADS										MRF	JVK-2018-04	SIGN:	CAMO	HNAB, SE.MG.0092			
SE-JVK	AS350BA	R.008	6	1922	1986	AIRFRAME "ASB" ADS										PAGE	of	Update EASA:	BW 2019-04	CAT = ASB-SB-TB	Date:	22-11 2018	
Date	ATA	SB	Rev	EASA	FAA-AD	FR-AD	MOD	ACTION				BA	PART	REP	F.DUE	D. DATE	CAT	REMARK	ACTION TAKEN	W.O.	DATE	MECH	
18-01	67			TC-STC CF-2017- 27				Flight Controls – Restriction of directional control pedal movement, Litter kits (P/Ns) 350-200034 or 350-200194 (LH litter kit) or P/N 350-200144 (RH litter kit).				X			1		ASB	STC # SH94-29, N	NA NOT INSTALLED	HNAB CAMO	2018-11-22	SE-MG.0092, ARS-3 LGD	
18-01	67			USA AD	2018-18-12			ENGINE AIR INTAKE SYSTEM- RFM REVISION				X			1		ASB	STC # SR02393CH, EASA IMR.R.S.01509	NA NOT INSTALLED	HNAB CAMO	2018-11-22	SE-MG.0092, ARS-3 LGD	